LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC **SENSORS**

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FI OW

SENSORS INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Fibers

FX-500 FX-100 FX-300

FX-410 FX-311

FX-301-F7/ FX-301-F

Digital Fiber Sensor

Related Information

- General terms and conditions...... F-7
- Glossary of terms / General precautions.... P.1455~ / P.1458~
- Sensor selection guide P.3~
- Korea's S-mark......P.1506

















Just "Look" and "Turn", Simple, easy-to-use fiber sensor

Incident light intensity and threshold value are displayed simultaneously


The incident light intensity and threshold value can be checked at the same time with no operations needed. In addition, no complex mode settings are needed when the values are adjusted.

Adjustment variations according to the individual have been eliminated

Accurate control of the adjuster threshold values by using numerical values is possible due to the digital display. This allows anybody to perform the same settings.

Easy-to-understand operating panel layout

The threshold value adjuster and operation mode switch are large and easy to see, and they can be operated with the same sensitivity as general-purpose photoelectric sensors. Functions which are not commonly used can be operated using a non-obtrusive setting switch.

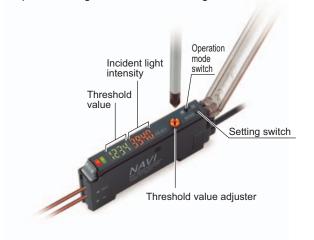


Threshold values can be changed smoothly

This sensor uses the R.S.S.* adjuster with a compact encoder inside. The sensitivity amount changes depending on the rotation speed of the adjuster, so that adjustment can be carried out speedily.

* Rotation Speed Sensitivity





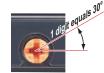

Adjustment in units of 1 digit is also easy No need for the fine changes in force required for photoelectric sensors.

Large endless adjuster

New concept

Standard screwdrivers can be used to turn the adjuster as well as precision screwdrivers. In addition, an "endless" mechanism is used which eliminates the possibility of any damage being caused by turning the adjuster too far.



Beam power greatly increased to give strong performance under adverse environments Red LED type


The beam power has been greatly increased. This means a longer sensing distance and less trouble from problems such as dust. These sensors have ample performance for workplace needs.



Improved stability over both long and short terms Red LED type

The red LED type sensors have a "four-chemical emitting element" which maintains stability of light emissions for long-term operation. Furthermore, all models have an "APC (Auto Power Control) circuit" which improves stability at times such as when the power is turned on. These features improve overall stability compared to previous models.

• Stable sensing comparison

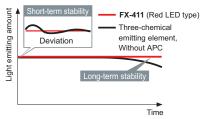

FX-412 can be turned by finger! New concept

The adjuster can be turned directly by finger, without the need for a screwdriver.



Three types are available, with red, blue and green light

Different sensors can be selected to suit the application.



Color combinations that can be discerned during mark sensing

Back- color ground color	White	Yellow	Orange	Red	Green	Blue	Black				
White		•	•	••	•••	•••	•••				
Yellow	•		•	•	• • •	•	•••				
Orange	•	•		••	•••	• • •	•••				
Red	•	•	••		•	•	• •				
Green	•••	•••	•••	•		•	•				
Blue	•••	•••	•••	• •	•		•				
Black	•••	•••	•••	••	•	•					

• :Red LED type • :Blue LED type • :Green LED type

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS INDUCTIVE

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS


FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Excellent workability and ease of maintenance

The same quick-connection cable that is used for sensors such as the **FX-300** series of digital fiber sensors is used. This means that they can be used together with other types of sensors such as laser sensors, and the number of power supply cables can be reduced.

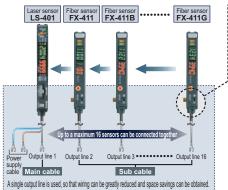

The sensors can be connected together with other sensors such as the FX-300 series of digital fiber sensors and the GA-311 of inductive proximity sensors. In addition, the SC series of sensor PLC connection units with MIL connector compatibility can also be used to further reduce the amount of wiring.

Connector type



Quick-connection cables can be used for power supply cascade wiring. Both main and sub units utilize the same amplifier body. Selection Guide Fibers Fiber Amplifiers

FX-500

FX-300

FX-410 FX-311

FX-301-F7/ FX-301-F

FIBER

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

> AREA SENSORS

LIGHT CURTAINS /
SAFETY
COMPONENTS
PRESSURE /
FLOW
SENSORS
INDUCTIVE
PROXIMITY

SENSORS PARTICULAR USE SENSORS

> SENSOF OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

> LASER MARKERS

> > PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION

UV CURING SYSTEMS

Selection Guide Fibers Fiber Amplifiers

FX-500 FX-100 FX-300

FX-410

FX-311

FX-301-F7/ FX-301-F


Contributing to device miniaturization

This fiber sensor is the smallest among the dual digital display types, contributing to device miniaturization.




Equipped with 3 types timers

Equipped with OFF-delay / ON-delay / ONE SHOT timer. (Timer period: 1 ms to 3 sec. approx.)

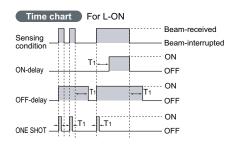


Interference prevention for up to 8 sets fiber heads (for U-LG)

The optical communication function allows up to a maximum of eight sets of fiber heads (four sets for FAST and STD settings) to be installed in contact with each other without mutual interference occurring. (Set automatically when power is turned on.)

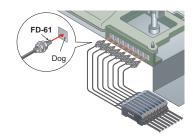


Key lock function prevents wrong operation

This prevents the operator from changing the threshold value by mistake.

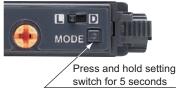

Ideal for dealing with saturation / Light-emitting amount selection function | Red LED type | New concept

In cases where the incoming light level can become saturated, such as during close-range sensing or when sensing transparent or minute objects, the sensor's light-emitting amount can be adjusted to provide more stable sensing without changing the response time.

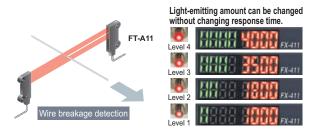

Digital display upside-down / off function

The digital display can be turned upside-down if required to suit the setup location. In addition, a stability indicator is also provided, so that the amount of light-receiving excess can be checked even when the display is turned off.



Hold function

Peak and bottom hold values for the incident light intensity can be displayed. This is useful for checking the incident light intensity during tasks such as drop detection.

In addition, the peak and bottom values can be checked while looking at the threshold value, which makes adjustment much easier.



ORDER GUIDE

Amplifiers Quick-connection cable is not supplied with the amplifier. Please order it separately.

Туре	Appearance	Model No.	Emitting element	Output
tput		FX-411	Red LED	
NPN output		FX-411B	Blue LED	NPN open-collector transistor
P		FX-411G	Green LED	
tput	MAY	FX-411P	Red LED	
PNP output		FX-411BP	Blue LED	PNP open-collector transistor
PN		FX-411GP	Green LED	
ŧ		FX-412 (Note)	Red LED	
NPN output	NAV	FX-412B (Note)	Blue LED	NPN open-collector transistor
Ż		FX-412G (Note)	Green LED	

Note: The FX-412 has a threshold value adjuster that can be adjusted with your fingers.

Quick-connection cables Quick-connection cable is not supplied with the amplifier. Please order it separately.

Туре	Model No.	Description						
	CN-73-C1	Length: 1 m 3.281 ft	0.2 mm² 3-core cabtyre cable,					
Main cable (3-core)	CN-73-C2	Length: 2 m 6.562 ft	with connector on one end Cable outer diameter: ø3.3 mm					
(3.3.2.7)	CN-73-C5	Length: 5 m 16.404 ft	ø0.130 in					
	CN-71-C1	Length: 1 m 3.281 ft	0.2 mm² 1-core cabtyre cable,					
Sub cable (1-core)	CN-71-C2	Length: 2 m 6.562 ft	with connector on one end Cable outer diameter: ø3.3 mm					
(1 2012)	CN-71-C5	Length: 5 m 16.404 ft	ø0.130 in					





End plates End plates are not supplied with the amplifier. Please order them separately when the amplifiers are mounted in cascade.

Appearance	Model No.	Description
	MS-DIN-E	When cascading multiple amplifiers, or when it moves depending on the way it is installed on a DIN rail, these end plates clamp amplifiers into place on both sides. Make sure to use end plates when cascading multiple amplifiers together. Two pcs. pet set

OPTIONS

Designation	Model No.	Description
Amplifier mounting bracket	MS-DIN-2	Mounting bracket for amplifier
Fiber amplifier protection seal	FX-MB1	10 sets of 2 communication window seals and 1 connector seal Communication window seal: It prevents malfunction due to transmission signal from another amplifier, as well as, prevents effect on another amplifier. Connector seal: It prevents contact of any metal, etc., with the pins of the quick-connection cable.


Amplifier mounting bracket

• MS-DIN-2



Fiber amplifier protection seal

• FX-MB1 Comn

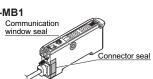

BER ENSORS

LASER SENSORS

ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

FLOW SENSORS

SENSORS PARTICULAR USE

USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

> MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Fibers Fiber Amplifiers

FX-500 FX-100

FX-100

FX-410

LIST OF FIBERS Thru-beam type (one pair set) Fibers are listed in alphabetic order. Refer to p.5~ "Fiber Selection" for details of each fiber. LASER SENSORS Sensing range (mm in) (Note 1) PHOTO-ELECTRIC SENSORS Red LED Blue LED Green LED Model No. Dimensions MICRO PHOTO-U-LG STD **FAST** U-LG STD **FAST** U-LG STD **FAST** SENSORS FT-140 19,600 771.654 (Note 2) 16,000 629.921 15,000 590.551 14,000 551.181 3,300 129.921 2,200 86.614 9,500 374.016 2,500 98.425 1,800 70.866 P 51 AREA SENSORS FT-30 P 51 600 23.62 145 5.709 95 3.74 90 3.54 24 0.94 15 0.591 45 12 0.47 8 0.315 LIGH CURTAINS FT-31 P.51 540 21.260 140 5.512 85 3.34 85 3.346 20 0.787 14 0.551 38 1.496 10 0.394 7 0.276 SAFETY COMPONENTS FT-31S 540 21.260 140 5.512 85 3.34 85 3.346 20 0.787 14 0.551 38 1.496 10 0.394 7 0.276 P.51 PRESSURE / FT-31W 380 14.961 80 3.150 55 2.16 53 2.087 0.630 0.354 28 1.102 0.27 4 0.157 P.51 SENSORS INDUCTIVE PROXIMITY SENSORS P.51 FT-40 1,600 62,922 345 13.583 245 9.64 250 9.843 65 2.559 45 1.772 140 5.512 40 1.57 25 0.984 P.51 FT-42 1 550 61 024 340 13 386 240 9 44 230 9 055 60 2.363 40 1 575 125 4 92 33 1 299 22 0.866 PARTICULAR FT-42S 1.29 P.51 SENSORS 1.550 61.024 340 13.386 240 9 44 230 9.05 60 2 362 40 1.575 125 33 22 0.86 2.244 P.51 FT-42W 1,300 51.181 290 11.417 210 8.268 220 8.661 1.299 4.331 1.260 19 0.748 SENSOR 120 FT-43 2,200 86.614 450 17.717 310 12.20 460 18.110 4.72 75 2.953 250 9.843 62 2 44 P.51 SIMPLE WIRE-SAVING UNITS P 52 FT-45X 1 600 62 992 370 14 567 280 11 024 260 10 236 64 2 520 45 1.772 130 5.118 34 1 330 23 0.906 3.600 141.732 (Note 2) 2,400 94,488 1,800 70.86 1.300 51.181 350 13.780 8.661 770 30.315 7.480 120 4.724 P.52 FT-A11 220 190 WIRE-SAVING SYSTEMS FT-A11W 3.600 141.732 (Note 2) 2.500 98.425 2.000 78.740 1.300 51.181 350 13.780 220 8.661 550 21.654 150 5.906 130 5.118 P.52 MEASURE MENT SENSORS FT-A32 3,600 141.732 (Note 2) 3,600 141.732 (Note 2) 380 14.961 P.52 3,600 141.732 (Note 2) 2,500 98.425 750 29.528 1,500 59.05 220 8.66 130 5.118 P.52 FT-A32W 3.600 141.732 (Note 2) 3 600 141 732 (Note 2) 3 600 141 732 (Note 2) 3 400 133 858 800 31 496 470 18 504 2 100 82 67 330 12 99 140 5.512 DEVICES FT-AL05 240 9.449 P.52 1.100 43.307 7.087 55 2.165 1.378 125 20 0.787 180 220 8.661 35 4.92 30 1.181 LASER MARKERS FT-E13 30 1.18 7 0.276 5 0.197 2.5 0.098 1 0.03 P.52 FT-E23 2 0.079 P.52 110 4.33 20 0.787 15 0.59 12 0.472 3 0.118 6 1 0.039 PLC FT-H13-FM2 1,100 43.307 280 11.024 200 7.874 1.969 13 0.512 9 0.354 150 5.906 16 0.630 10 0.394 P.52 50 HUMAN MACHINE INTERFACES 700 27 559 6 299 4 33 4 724 2 36 P 53 FT-H20-J20-S (Note 3) 160 110 120 20 0.787 60 ENERGY CONSUMPTION FT-H20-J30-S (Note 3) 4.331 4.724 P.53 700 27.559 160 6.299 110 120 0.787 60 2.36 20 VISUALIZATION COMPONENTS FT-H20-J50-S (Note 3) 700 27.559 160 6.299 110 4.33 120 4.724 20 0.787 60 2.36 P.53 COMPONENTS FT-H20-M1 550 21.654 150 5.906 100 3.93 100 3.937 0.984 20 0.787 65 2 55 17 0.669 12 0.472 P.53 25 MACHINE FT-H20-VJ50-S (Note 3) 1,100 43.307 240 9.449 170 6.69 170 6.693 35 1.378 90 3.54 P.53 VISION FT-H20-VJ80-S (Note 3) 1.100 43.307 9.449 6.693 3.543 P.53 240 170 170 6.693 35 1.378 90 CURING SYSTEMS FT-H20W-M1 400 15.748 4.331 0.748 13 0.512 13 0.512 9 0.35 P.53 110 80 75 19 58 FT-H30-M1V-S (Note 4) 390 15.354 3.937 70 2.756 2.953 0.787 15 0.591 2.165 13 0.512 10 0.394 P.53 100 75 20 55 FT-H35-M2 600 23,622 150 5.906 110 4.33 115 4.528 28 1.102 20 0.787 90 3 543 20 0.78 14 0.55 P.53 115 4 528 P 53 FT-H35-M2S6 600 23 622 150 5 906 110 4 331 28 1 102 20 0.787 90 3 543 20 0 787 14 0.551 FT-HL80Y 3,500 137.795 (Note 2) 800 31.496 550 21.654 150 5.906 35 1.378 20 0.787 200 7.874 55 2.165 35 1.378 P.53 Selection Guide FT-KS40 3,600 141.732 (Note 2) 2,000 78.740 1,900 74.803 1,000 39.370 270 10.630 7.480 590 23.228 53 2.087 P.54 190 130 5.118 Fibers FT-KV26 880 34.646 170 6.693 120 4.72 1.220 3.543 18 P 54 130 5.118 31 90 0.70 Fibe 3 600 141 732 (Note 2) 1 700 66 929 1 300 51 181 1 200 47 244 310 12 20! 190 7.480 800 31 49 190 7 480 120 4 72 P.54 FT-KV40 420 16.53 FT-KV40W 1,600 62.992 1,100 43.307 270 10.630 65 2.559 P.54 3.600 141.732 (Note 2) 900 35,433 140 5.512 100 3 937 FX-500 FT-L80Y 3.500 137.795 (Note 2) 900 35,433 600 23.62 9.843 2.362 1.575 300 11.811 70 2.75 45 1.772 P.54 FX-100 0.39 FT-R31 380 14.96 3.110 3.150 0.787 0.512 0.276 P 54 FX-300 79 56 80 20 13 38 1.49 10 P.54 240 9.449 FX-410 FT-R40 1.200 47.244 170 6.693 200 7.874 50 1.969 32 1.260 100 3.937 28 1.102 19 0.748 290 11.417 7.874 8.661 2.244 1.299 3.937 1.024 18 0.709 P.54 FX-311 FT-R41W 1,200 47,244 200 220 57 33 100 26 FX-301-F7/ FX-301-F FT-R42W 3.600 141.732 (Note 2) 990 38.976 740 29.134 310 12.205 75 2.95 58 2.283 270 10.630 2.75 1.969 P.54 70 50 FT-R43 1,200 47.244 230 9.055 160 6.29 200 7.874 50 1.969 32 1.260 100 3.937 26 1.024 18 0.709 P.54 P.55 FT-R44Y 1 200 47 244 230 9 055 160 6 29 200 7 874 50 1 969 32 1 260 100 3 937 26 1 024 18 0.709 FT-R60Y P.55 3 600 141 732 (Note 2) 750 29 528 540 21 26 560 22 047 140 5 512 3 543 290 11 417 1 969 90 75 2 95 50 FT-S11 2 P.55 150 5.906 30 1.181 20 0.78 21 0.827 5 0.197 3.5 0.138 12 0.472 0.079 1.5 0.05 12 0.472 FT-S20 600 23.622 5.709 0.945 P.55 145 95 3.740 90 3.543 24 15 0.591 45 8 0.31

Notes: 1) Note that the sensing range of the free-cut type fiber may be reduced by 20 % max. depending upon how the fiber is cut

85 3.346

The fiber cable length practically limits the sensing range.

140 5.512

540 21.260

FT-S21

85 3.346

20 0.787

14 0.551

38 1.496

10 0.394

P.55

7 0.276

³⁾ Heat-resistant joint fibers and ordinary-temperature fibers (FT-42) are sold as a set.

⁴⁾ Sold as a set comprising vacuum type fiber + photo-terminal (FV-BR1) + fiber at atmospheric side (FT-J8).

LIST OF FIBERS

Thru-beam type (one pair set)



Fibers are listed in alphabetic order. Refer to p.5~ "Fiber Selection" for details of each fiber.

	Sensing range (mm in) (Note 1)										
Model No.		Red LED			Blue LED			Green LED		Dimensions	
	U-LG	STD	FAST	U-LG	STD	FAST	U-LG	STD	FAST		
FT-S21W	380 14.961	80 3.150	55 2.165	53 2.087	16 0.630	9 0.354	28 1.102	7 0.276	4 0.157	P.55	
FT-S30	1,600 62.992	345 13.583	245 9.646	250 9.843	65 2.559	45 1.772	140 5.512	40 1.575	25 0.984	P.55	
FT-S31W	1,300 51.181	290 11.417	210 8.268	220 8.661	57 2.244	33 1.299	110 4.331	32 1.260	19 0.748	P.55	
FT-S32	3,600 141.732 (Note 2)	920 36.220	670 26.378	700 27.559	180 7.087	110 4.331	400 15.748	92 3.622	62 2.441	P.55	
FT-V23	720 28.346	140 5.512	100 3.937	120 4.724	30 1.181	20 0.787	65 2.559	16 0.630	9 0.354	P.55	
FT-V24W	140 5.512	25 0.984	20 0.787	18 0.709	2 0.079		5 0.197			P.56	
FT-V25	360 14.173	70 2.756	50 1.969	57 2.244	10 0.394	7 0.276	28 1.102	8 0.315	5 0.197	P.56	
FT-V30	770 30.315	160 6.299	120 4.724	210 8.268	47 1.850	28 1.102	100 3.937	22 0.866	10 0.394	P.56	
FT-V40	3,600 141.732 (Note 2)	950 37.402	730 28.740	810 31.890	190 7.480	130 5.118	500 19.685	115 4.528	81 3.189	P.56	
FT-V80Y	1,500 59.055	350 13.780	250 9.843	240 9.449	55 2.165	35 1.378	180 7.087	38 1.496	24 0.945	P.56	
FT-Z20HBW	390 15.354	80 3.150	55 2.165	64 2.520	16 0.630	10 0.394	30 1.181	7 0.276	5 0.197	P.56	
FT-Z20W	1,300 51.181	270 10.630	190 7.480	170 6.693	39 1.535	23 0.906	92 3.622	19 0.748	11 0.433	P.56	
FT-Z30	3,100 122.047	660 25.984	480 18.898	250 9.843	60 2.362	37 1.457	190 7.480	51 2.008	33 1.299	P.56	
FT-Z30E	3,600 141.732 (Note 2)	1,200 47.244	920 36.220	960 37.795	250 9.843	160 6.299	460 18.110	120 4.724	83 3.268	P.56	
FT-Z30EW	3,600 141.732 (Note 2)	590 23.228	430 16.929	940 37.008	180 7.087	110 4.331	400 15.748	85 3.346	56 2.205	P.57	
FT-Z30H	3,600 141.732 (Note 2)	1,300 51.181	950 37.402	1,100 43.307	290 11.417	170 6.693	580 22.835	150 5 .906	100 3.937	P.57	
FT-Z30HW	3,600 141.732 (Note 2)	1,300 51.181	950 37.402	940 37.008	180 7.087	110 4.331	400 15.748	85 3.346	56 2.205	P.57	
FT-Z30W	2,400 94.488	540 21.260	390 15.354	180 7.087	45 1.772	28 1.102	160 6.299	34 1.339	21 0.827	P.57	
FT-Z40HBW	1,300 51.181	290 11.417	210 8.268	220 8.661	57 2.244	33 1.299	110 4.331	32 1.260	19 0.748	P.57	
FT-Z40W	2,200 86.614	460 18.110	340 13.386	380 14.961	90 3.543	63 2.480	170 6.693	45 1.772	30 1.181	P.57	
FT-Z802Y	3,500 137.795 (Note 2)	750 29.528	540 21.260	450 17.717	110 4.331	80 3.150	300 11.811	80 3.150	60 2.362	P.57	

Notes: 1) Note that the sensing range of the free-cut type fiber may be reduced by 20 % max. depending upon how the fiber is cut.

The fiber cable length practically limits the sensing range.

Retroreflective type



Fibers are listed in alphabetic order. Refer to p.5~ "Fiber Selection" for details of each fiber.

		Sensing range (mm in) (Note 1,2)										
Model No.	Red LED				Blue LED			Green LED				
	U-LG	STD	FAST	U-LG	STD	FAST	U-LG	STD	FAST			
FR-KZ22E	15 to 350 0.591 to 13.780	15 to 140 0.591 to 5.512	15 to 100 0.591 to 3.937	20 to 100 0.787 to 3.937						P.58		
FR-KZ50E	20 to 400 0.787 to 15.748	20 to 200 0.787 to 7.874	20 to 200 0.787 to 7.874	20 to 200 0.787 to 7.874	20 to 84 0.787 to 3.307	20 to 45 0.787 to 1.771	20 to 180 0.787 to 7.087	20 to 55 0.787 to 1.969		P.58		
FR-KZ50H	20 to 400 0.787 to 15.748	20 to 200 0.787 to 7.874	20 to 200 0.787 to 7.874	20 to 145 0.787 to 5.709	20 to 47 0.787 to 1.850	20 to 26 0.787 to 1.024	20 to 145 0.787 to 5.709	20 to 47 0.787 to 1.850	20 to 26 0.787 to 1.024	P.58		
FR-Z50HW	100 to 1,000 3.937 to 39.370	100 to 540 3.937 to 21.260	100 to 460 3.937 to 18.110	100 to 490 3.937 to 19.291						P.58		

Notes: 1) Note that the sensing range of the free-cut type fiber may be reduced by 20 % max. depending upon how the fiber is cut.

The sensing range of FR-KZ22E is specified for the attached reflector.

The sensing range of FR-KZ50E and FR-KZ50H is specified for the attached reflector RF-003. The sensing range of FR-Z50HW is specified for the RF-13.

Sensing range when using in combination with FR-Z50HW reflector (Optional)

The sensing ranges are the value for red LED types.

		Sensing range (mm in)								
Reflector Model No.	FX-411									
Wiodol 140.	U-LG		S	TD	FAST					
RF-230	100 to 12,000	3.937 to 47.244	100 to 1,700	3.937 to 66.929	100 to 1,300	3.937 to 51.181				
RF-220	100 to 2,200	3.937 to 8.661	100 to 950	3.937 to 37.402	100 to 730	3.937 to 28.740				
RF-210	100 to 2,100	3.937 to 82.677	100 to 780	3.937 to 30.709	100 to 620	3.937 to 24.409				

Note: The sensing range is the possible setting range for the reflector. The fiber can detect an object less than setting range for the reflector. However, note that if there are any white or highly-reflective surfaces near the fiber head, reflected incident light may affect the fiber head. If this occurs, adjust the threshold value of the amplifier unit before use.

LASER SENSORS

PHOTO- ELECTRIC SENSORS	
MICRO PHOTO- ELECTRIC SENSORS	
ADEA	

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING UNITS WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Fibers

FX-500

FX-100 FX-300

FX-410

²⁾ The sensing range is the possible setting range for the attached reflector. The fiber can detect an object less than setting range for the reflector. However, note that if there are any white or highly-reflective surfaces near the fiber head, reflected incident light may affect the fiber head. If this occurs, adjust the threshold value of the amplifier unit before use.

FIBER SENSORS LASER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS

SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

LASER MARKERS

HUMAN MACHINE INTERFACES

COMPONENTS

MACHINE VISION SYSTEMS

Fibers

FX-500 FX-100 FX-300

FX-311 FX-301-F7/ FX-301-F

PLC

LIST OF FIBERS

Reflective type



Fibers are listed in alphabetic order. Refer to p.5 \sim "Fiber Selection" for details of each fiber.

Sensing range (mm in) (Note 1, 2) / Description										
Model No.		Red LED		ong rango (n	Blue LED	1, 2,7 200011	Alon	Green LED		Dimensions
Wiodel 140.	U-LG	STD	FAST	U-LG	STD	FAST	U-LG	STD	FAST	Dillicitorio
FD-30	200 7.874	48 1.890	35 1.378	40 1.575	9 0.354		18 0.709	5 0.197	3 0.118	P.59
FD-31	175 6.890	45 1.772	34 1.339	35 1.378	8 0.315		16 0.630	4 0.157	2 0.079	
FD-31W	120 4.724	20 0.787	15 0.591	16 0.630		1 to 2.5 0.039 to 0.098		1 to 2.5 0.039 to 0.098		P.59
FD-32G	240 9.449	52 2.047	38 1.496	48 1.890	11 0.433		24 0.945	5 0.197	4 0.157	P.59
FD-32GX	320 12.598	50 1.969	38 1.496	50 1.969	12 0.472		24 0.945	7 0.276	4 0.157	
FD-40	200 7.874	48 1.890	35 1.378	40 1.575	9 0.354		18 0.709	5 0.197	3 0.118	
FD-41	175 6.890	45 1.772	34 1.339	35 1.378	8 0.315		16 0.630	4 0.157	2 0.079	
FD-41S	175 6.890	40 1.575	30 1.181	35 1.378	8 0.315		16 0.630	4 0.157	2 0.079	P.59
FD-41SW	120 4.724	20 0.787	15 0.591	18 0.709		1 to 2.5 0.039 to 0.098		1 to 2.5 0.039 to 0.098		P.59
FD-41W	330 12.992	70 2.756	50 1.969		0.5 to 13 0.020 to 0.512			1.5 to 7 0.059 to 0.276	1 5 to 4 5 0059 to 0.177	P.59
FD-42G	240 9.449	52 2.047	38 1.496	48 1.890	11 0.433		24 0.945	5 0.197	4 0.157	P.60
FD-42GW	240 9.449	40 1.575	30 1.181	30 1.181	7 0.276		15 0.591	4 0.157	2 0.079	
FD-42GVV FD-60	600 23.622	150 5.906	100 3.937	130 5.118	30 1.181	20 0.787	70 2.756	20 0.787	13 0.512	
FD-61	510 20.079	140 5.512	90 3.543	105 4.134	27 1.063		65 2.559	16 0.630	11 0.433	
FD-61G	460 18.110	110 4.331	80 3.150	105 4.134	27 1.063		55 2.165	15 0.591	9 0.354	P.60
FD-61S	500 19.685	140 5.512	95 3.740	105 4.134	27 1.063		65 2.559	16 0.630	11 0.433	
FD-61W	330 12.992	70 2.756	50 1.969		0.5 to 13 0.020 to 0.512			1.5 to 7 0.059 to 0.276		P.60
FD-61W	820 32.283	180 7.087	130 5.118			1 to 29 0.039 to 1.142		1 to 26 0.039 to 1.024		P.60
	380 14.961	80 3.150								P.61
FD-64X FD-A16	200 7.874	100 3.937			13 0.512	0.5 to 9 0.020 to 0.354	27 1.063 57 2.244	0.5 to 7 0.020 to 0.276	0.5 (0 4.5 0.020 (0 0.177	P.61
FD-AL11	460 18.110	100 3.937	75 2.953	30 1.181 70 2.756	17 0.669		45 1.772	9 0.354	6 0.236	
			70 2.756					9 0.354	0 0.230	P.61
FD-E13 FD-E23	20 0.787	4 0.157	3 0.118	2.5 0.098	0.7 0.028		1.5 0.059	1.2 0.051	0.0.0025	
	75 2.953	15 0.591	10 0.394	10 0.394 10 0.394	2.5 0.098		5 0.197	1.3 0.051	0.9 0.035	
FD-EG30 FD-EG30S	90 3.543	15 0.591	10 0.394		2.5 0.098		5 0.197	1.3 0.051	0.9 0.035	
	85 3.346	15 0.591	10 0.394	10 0.394	2.5 0.098		5 0.197	1.3 0.051	0.9 0.035	P.62
FD-EG31	25 0.984	5 0.197	4 0.157	4 0.157 eter: Outer dia.	1 0.039		2 0.079	nt nino		P.02
FD-F4		[PFA (fluorine resin)	or equivalently t received, Liquid	ransparent pip	e, wall thicknes				P.62
FD-F41	[1	PVC (vinyl chlor	ide), fluorine re	dia. ø6 to ø26 esin, polycarbon	ate, acrylic, gla	ass, wall thickne		0.039 to 0.118 i	n]	P.62
	L	•	eam received, l	Liquid present: I	seam interrupt	tea				
FD-F41Y (Note 3)		Protec	tive tube: Fluor	rine resin, length ntacted: Beam r				errupted		P.62
FD-F8Y		Protec		ine resin, length itacted: Beam re				rrupted		P.62
FD-FA93	(When used with	n the tying band	r dia. ø8 mm ø0 ds: ø8 to ø80 mi translucent] Ligi	m ø0.315 to ø	3.150 in)		eam interrupte	d	P.62
FD-H13-FM2	430 16.929	100 3.937	70 2.756	40 1.575	10 0.394	7 0.276	40 1.575	10 0.394	7 0.276	P.63
FD-H18-L31	0 to 25 0 to 0.984	0 to 10 0 to 0.394	0 to 8 0 to 0.315							P.63
FD-H20-21	350 13.780	90 3.543	65 2.559	65 2.559	13 0.512	9 0.354	45 1.772	10 0.394	7 0.276	P.63
FD-H20-M1	270 10.630	85 3.346	60 2.362	60 2.362	14 0.551	10 0.394	58 2.283	10 0.394	7 0.276	P.63
FD-H25-L43 (Note 4)	2.5 to 29		4 to 16							P.63
FD-H25-L45 (Note 4)	5 to 42	0.157 to 0.787 7 to 38	7 to 35							P.63
Notes: 1) Note tha		0.276 to 1.496		nov bo roduced	h., 20 0/ may	dononding	n how the fiber	io out		00

Notes: 1) Note that the sensing range of the free-cut type fiber may be reduced by 20 % max. depending upon how the fiber is cut.

The sensing range is specified for white non-glossy paper.

³⁾ Liquid inflow prevention joint, protective tube extension joint, fiber mounting joint are available. Please refer to p.38 for details.

⁴⁾ The sensing range is specified for transparent glass 100 × 100 × t0.7 mm 3.937 × 3.937 × t0.028 in

LIST OF FIBERS

Reflective type



Fibers are listed in alphabetic order. Refer to p.5~ "Fiber Selection" for details of each fiber.

T IDETO GITC HOLEG	Sensing range (mm in) (Note 1, 2) / Description									
Model No.		Red LED			Blue LED	<u> </u>		Green LED		Dimensions
	U-LG	STD	FAST	U-LG	STD	FAST	U-LG	STD	FAST	
FD-H30-KZ1V-S (Note 3,4)		25 to 100 0 984 to 3 937	25 to 45 0.984 to 1.772							P.64
FD-H30-L32										P.64
FD-H30-L32V-S		1.5 to 5	2 to 4							P.64
(Note 3,4) FD-H35-20S	0 to 0.433 210 8.268	50 1.969	0.079 to 0.157 35 1.378	45 1.772	10 0.394	7 0.276	20 0.787	6 0.236	4 0.157	P.64
FD-H35-203 FD-H35-M2	300 11.811	83 3.268	60 2.362	50 1.969	12 0.472	9 0.354	50 1.969	10 0.394	7 0.276	
FD-H35-M2S6	300 11.811	80 3.150		50 1.969	14 0.551	10 0.394	40 1.575	10 0.394	7 0.276	
FD-HF40Y	000 11.011						85 in (allowable		1 0.210	
(Note 5)		· ·					ed: Beam interru			P.64
FD-L10 (Note 3)			0 to 3.8 0 to 0.150	3.5 0.138	2.5 0.098	2 0.079				P.65
FD-L11 (Note 3)				8.5 0.335	6 0.236	5.5 0.217	8 0.315	5 0.197		P.65
FD-L12W (Note 3)									-	P.65
FD-L20H			4.5 to 10 0.177 to 0.394	4 to 13 0.157 to 0.512	5 to 9 0.197 to 0.354	5.5 to 8.5 0.217 to 0.334	5 to 11 0.197 to 0.433	6 to 8.5 0.236 to 0.335		P.65
FD-L21 (Note 3)										P.65
FD-L21W (Note 3)										P.65
FD-L22A (Note 3)										P.65
FD-L23 (Note 3)										P.65
FD-L30A (Note 3)										P.65
FD-L31A (Note 3)										P.65
FD-L32H (Note 3)					0.0054	0.0000	04 0 007		0.0070	P.66
FD-R31G	240 9.449	42 1.654	30 1.181	41 1.614	9 0.354	6 0.236	21 0.827	5 0.197	2 0.079	
FD-R32EG	90 3.543	15 0.591	10 0.394	10 0.394	2.5 0.098	1.5 0.059	5 0.197	1.3 0.051		P.66
FD-R33EG	25 0.984	5 0.197	3 0.118	4 0.157	0.8 0.031	4 0 000	2 0.079	0.0.0005		P.66
FD-R34EG	75 2.953	13 0.512	8 0.315	9 0.354	2 0.079	1 0.039 1 to 8 0.039 to 0.315	5 0.197	0.9 0.035	1 to 5 0.039 to 0.197	P.66
FD-R41 FD-R60	330 12.992 420 16.535	65 2.559 110 4.331	47 1.850 80 3.150	51 2.008 82 3.228	10 0.394 23 0.906	15 0.591	25 0.984 59 2.323	1 to 6 0.039 to 0.236	10 0.394	P.66 P.66
FD-R61Y	340 13.386	65 2.559	47 1.850		0.5 to 15 0.020 to 0.591			0.5 to 7 0.020 to 0.276	1 to 5 0.039 to 0.197	
FD-R011	80 3.150	18 0.709	13 0.512	12 0.472	2.5 0.098	2 0.079	6.5 0.256	1.5 0.059	1 0.039	
FD-S30	200 7.874	48 0.890		40 1.575	9 0.354	6 0.236	18 0.709	5 0.197	3 0.118	
FD-S31	175 6.890	45 1.772	34 1.339	35 1.378	8 0.315	5 0.197	16 0.630	4 0.157	2 0.079	
FD-S32	510 20.079	120 4.724			27 1.063	18 0.709	65 2.559	16 0.630		
FD-S32W	330 12.992	70 2.756			0.5 to 13 0.020 to 0.512			1.5 to 7 0.059 to 0.276		
FD-S33GW	240 9.449			30 1.181	7 0.276	5 0.197	15 0.591	4 0.157	2 0.079	
FD-S60Y	410 16.142			120 4.724	25 0.984	17 0.669	65 2.559	10 0.394		P.67
FD-V30	110 4.331	19 0.748		18 0.709			10 0.394			P.67
FD-V30W	30 1.181	5 0.197	3 0.118							P.67
FD-V50	160 6.299			27 1.063	7 0.276		16 0.630			P.68
			3 to 15 0.118 to 0.591				3 to 8 0.118 to 0.315			P.68
FD-Z20W			3 to 17 0.118 to 0.669							P.68
FD-Z40HBW					3 to 20 1.181 to 0.787	3 to 13 1.181 to 0.512	1 to 42 0.039 to 1.654	3 to 11 0.118 to 0.433	3 to 7 0.118 to 0.276	P.68
FD-Z40W			1 to 48 0.039 to 1.890				3 to 25 0.118 to 0.984			P.68
FD-Z50HW			15 to 160 0.591 to 6.299				20 to 55 0.787 to 2.165			P.68
										1

- Notes: 1) Note that the sensing range of the free-cut type fiber may be reduced by 20 % max. depending upon how the fiber is cut.

 2) The sensing range of reflective type is the value for white non-glossy paper (as for **FD-H30-L32** and **FD-H18-L31** 50 × 50 mm 1.969 × 1.969 in glass
 - 3 The sensing range is specified for transparent glass 100 × 100 × t0.7 mm 3.937 × 3.937 × t0.028 in (FD-L32H: R edge, FD-L21 and FD-L21W: t2 mm t0.079 in) [FD-L10: silicon wafers 100 × 100 mm 3.937 × 3.937 in].

 4) Sold as a set comprising vacuum type fiber + photo-terminal (FV-BR1) + fiber at atmospheric side (FT-J8).

 - 5) Liquid inflow prevention joint, protective tube extension joint, fiber mounting joint are available. Please refer to p.38 for details.

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SIMPLE WIRE-SAVING UNITS WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS MACHINE VISION SYSTEMS

UV CURING SYSTEMS

FX-500 FX-100 FX-300 FX-311 FX-301-F7/ FX-301-F



FIBER OPTIONS

Refer to p.69~ for details of lens dimensions.

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS MEASURE-MENT SENSORS STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

COMPONENTS FA MACHINE VISION SYSTEMS CURING SYSTEMS

Selection Guide Fibers

FX-500 FX-100 FX-300

FX-311 FX-301-F7/ FX-301-F

Lens (for thru-beam type fiber)

Lei	is (for thru	-beam type t	iber)								
D	esignation	Model No.			Description	1					
				Increases the sensing Sensing range for red LED type (mm in) [Lens on both sides] (Note 2)							
				range by 5 times or more.	Mode Fiber	U-LG	STD	FAST			
		FX-LE1		Ambient	FT-43	3,600 141.732 (Note 3)	2,300 90.551	1,700 66.929			
	Expansion		Marie Control	temperature: -60 to +350 °C	FT-42	3,600 141.732 (Note 3)	3,200 125.984	2,300 90.551			
	lens (Note 1)		_ =====================================		FT-45X	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)			
	(Note 1)			–76 to +662 °F	FT-R40	3,600 141.732 (Note 3)	2,900 114.173	2,300 90.551			
			A CONTRACTOR OF THE PARTY OF TH	(Note 5) • Beam dia:	FT-H35-M2	3,500 137.795 (Note 3)	1,100 43.307	800 31.496			
				ø3.6 mm	FT-H20W-M1	1,600 62.992 (Note 3)	1,200 47.244	800 31.496			
				ø0.142 in	FT-H20-M1	1,600 62.992 (Note 3)	800 31.496	600 23.622			
				Tremendously	Sensing range fo	r red LED type (mi	m in) [Lens on bot	th sides] (Note 2)			
				increases the sensing range with large diameter lenses.	Mode Fiber	U-LG	STD	FAST			
					FT-43	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)			
	Super-			Ambient	FT-42	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)			
	expansion	FX-LE2		temperature:	FT-45X	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)			
	lens (Note 1)			–60 to +350 °C	FT-R40	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)	3,600 141.732 (Note 3)			
	(Note 1)			–76 to +662 °F	FT-H35-M2	3,500 137.795 (Note 3)	3,500 137.795 (Note 3)	3,500 137.795 (Note 3)			
ber				(Note 5) • Beam dia:	FT-H20W-M1	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)			
e fib				ø9.8 mm	FT-H20-M1	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)	1,600 62.992 (Note 3)			
typ				ø0.386 in	FT-H13-FM2	3,500 137.795 (Note 3)	3,500 137.795 (Note 3)	3,500 137.795 (Note 3)			
eam				Beam axis is bent by	Sensing range for	r red LED type (mi	m in) [Lens on bot	th sides] (Note 2)			
For thru-beam type fiber				90°. • Ambient	Mode	U-LG	STD	FAST			
or t					FT-43	2,300 90.551	480 18.898	350 13.780			
ш	Side-view	EV 0)/4		temperature:	FT-43	2,400 94.488	450 17.717	330 12.992			
	lens	FX-SV1		-60 to +300 °C -76 to +572 °F	FT-45X	1,600 62.992 (Note 3)	530 20.866	370 14.567			
				(Note 5)	FT-H35-M2	870 34.252	220 8.661	160 6.299			
				Beam dia:	FT-H20W-M1	750 29.528	200 7.874	140 5.512			
				ø2.8 mm ø0.110 in	FT-H20-M1	870 34.252	220 8.661	160 6.299			
				Sensing range increases	Sensing range for						
	Expansion			by 4 times or more. • Ambient temperature:	Mode		STD	FAST			
	lens for	FV-LE1		-60 to +350 °C -76 to +662 °F (Note 5)		4 000 00 000	450 47 747	000 44 044			
	vacuum fiber (Note 1)		The state of the s	Beam dia:	F1-H30-M1V-S	1,600 62.992	450 17.717	300 11.811			
				ø3.6 mm ø0.142 in							
	V.			Beam axis is bent by 90°.	Sensing range for	red LED type (mm	in) [Lens on both	sides] (Note 2, 4)			
	Vacuum resistant	E) (0) (0	0.9 Da 30	Ambient temperature: -60 to +300 °C	Fiber Mode	U-LG	STD	FAST			
	side-view lens	FV-SV2	The state of the s		FT-H30-M1V-S	1,600 62.992	450 17.717	300 11.811			
	(Note 1)		Cielle 1	Beam dia: ø3.7 mm ø0.146 in							

Notes: 1) Be careful sure to use it only after you have adjusted it sufficiently when installing the thru-beam type fiber equipped with the expansion lens, as the beam envelope becomes narrow and alignment is difficult.

- 2) The sensing ranges are the values for red LED type amplifier. Please contact our office for details on sensing ranges for other types of amplifiers.

 3) The fiber cable length practically limits the sensing range.

 4) The fiber cable length for the FT-J8 atmospheric side fiber.
- 5) Refer to p.15, p.18, p.33 and p.35 for the ambient temperatures of fibers to be used in combination.

FIBER OPTIONS

Refer to p.69~ for details of lens dimensions.

Lens (for reflective type fiber)

Designation		Model No.	Description							
	Pinpoint spot lens	FX-MR1		Pinpoint spot of ø0.5 mm ø0.020 in. Enables detection of minute objects or small marks. • Distance to focal point: 6 ±1 mm 0.236 ±0.039 in • Applicable fibers: FD-42G, FD-42GW • Ambient temperature: -40 to +70 °C -40 to +158 °F (Note 2)						
				The spot diameter is adjustable from Sensing range for red LED type (Note 1)						
			Screw-in ♣	Ø0.7 to Ø2 mm Ø0.028 to Ø0.079 in according to how much the fiber is	Screw-in depth	Distance to focal point	Spot diameter			
	Zoom lens	FX-MR2	depth –	screwed in. • Applicable fibers: FD-42G, FD-42GW	7 mm 0.276 in	ø18.5 mm ø0.728 in approx.	ø0.7 mm ø0.028 in			
	Zoom lens	FA-IVIRZ	Distance to focal point Spot Spot diameter	Ambient temperature:	12 mm 0.472 in	ø27 mm ø1.063 in approx.	ø1.2 mm ø0.047 in			
				-40 to +70 °C -40 to +158 °F (Note 1) • Accessory: MS-EX3 (mounting	14 mm 0.551 in	ø43 mm ø1.693 in approx.	ø2.0 mm ø0.079 in			
				bracket)						
<u></u>		H X IVIR 3	Distance to focal point	Extremely fine spot of ø0.15 mm ø0.006 in approx. achieved. • Applicable fibers: FD-EG31, FD-EG30, FD-42G, FD-42GW, FD-32G, FD-32GX • Ambient temperature: -40 to +70 °C -40 to +158 °F (Note 2)	Sensing range for red LED type (Note 1)					
fibe	Finest spot lens				Fiber	Distance to focal point	Spot diameter			
type					FD-EG31	7.5 ±0.5 mm 0.295 ±0.020 in	ø0.15 mm ø0.006 in approx.			
tive					FD-EG30	7.5 ±0.5 mm 0.295 ±0.020 in	ø0.3 mm ø0.012 in approx.			
For reflective type fiber					FD-42G/42GW FD-32G/32GX	7.5 ±0.5 mm 0.295 ±0.020 in	ø0.5 mm ø0.020 in approx.			
For					Sensing range for red LED type (Note 1)					
				Extremely fine spot of Ø0.1 mm Ø0.004 in approx. achieved.	Fiber	Distance to focal point	Spot diameter			
	Finest	EV MDC	Spot diameter	Applicable fibers: FD-EG31, FD-EG30, FD-430, FD-4300, FD-4300		7 ±0.5 mm 0.276 ±0.020 in	ø0.1 mm ø0.004 in approx.			
	spot lens	lens FX-MR6		FD-EG30, FD-42G, FD-42GW, FD-32G, FD-32GX • Ambient temperature: -20 to +60 °C -4 to +140 °F (Note 2)	FD-EG30	7 ±0.5 mm 0.276 ±0.020 in	Ø0.2 mm Ø0.008 in approx.			
					FD-42G/42GW FD-32G/32GX	7 ±0.5 mm 0.276 ±0.020 in	ø0.4 mm ø0.016 in approx.			
			O in do nth			r red I ED tree (No	to 1)			
			Screw-in depth	FX-MR2 is converted into a side-view		r red LED type (No				
	Zoom lens /Side-view \	EV 1405		type and can be mounted in a very small space. • Applicable fibers: FD-42G, FD-42GW • Ambient temperature: -40 to +70 °C -40 to +158 °F (Note 2)	Screw-in depth	Distance to focal point	Spot diameter			
	(type	CAIVIEA II			8 mm 0.315 in	13 mm 0.512 in approx.	ø0.5 mm ø0.020 in			
					10 mm 0.394 in	15 mm 0.591 in approx.	ø0.8 mm ø0.031 in			
			-iSpot diameter	10 to 170 to 10 to 1700 1 (Note 2)	14 mm 0.551 in	30 mm 1.181 in approx.	ø3.0 mm ø0.118 in			

Notes: 1) The sensing ranges are the values when used in combination with red LED type amplifier. Please contact our office for details on sensing ranges for other types of amplifier.

2) Refer to p.16 or p.26 for the ambient temperatures of fibers to be used in combination.

PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Fibers

FX-500 FX-100

FX-300 FX-410

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS SENSOR OPTIONS

MEASURE-MENT SENSORS

LASER MARKERS

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Fibers

FX-500

FX-100 FX-300

FX-311 FX-301-F7/ FX-301-F

PLC

HUMAN
MACHINE
INTERFACES

FIBER OPTIONS

Refer to p.69~ for details of lens dimensions.

Lens (For square head M3 reflective fiber)

Туре		Spot diameter	Distance to	Lens		Fiber		
		(mm in) (Note)	focal point (mm in) (Note)	Shape (mm in)	Model No.	Shape	Emitting fiber core (mm in)	Model No.
	Finest spot lens	Ø0.1 Ø0.004 approx.] •	ø0.125 ø0.005	FD-R33EG	
fiber						Ø0.125 Ø0.005 Ø0.175 Ø0.007 Ø0.25 Ø0.010	FD-EG31	
		ø0.15 ø0.006 approx.					ø0.175 ø0.007	FD-R34EG
reflective							ø0.25 ø0.010	FD-R32EG
M3				15.3		ø0.25 ø0.010	FD-EG30	
head I			0.276 ±0.020	ø5 ø0. <u>197</u> ▲	FA-IVIR/	Ø0.5 Ø0.020 Ø0.5 Ø0.020	ø0.5 ø0.020	FD-R31G
Square h							FD-32G	
r Squ					Ø0.5 Ø0.020	FD-32GX		
For						Ø0.5 Ø0.020	FD-42G	
							ø0.5 ø0.020	FD-42GW

		Spot diameter	Consing range	Lens		Applicable fibers	
Ту	ре	(mm in) (Note)	Sensing range (mm in) (Note)) Snape Model No E		Emitting fiber core (mm in)	Model No.
ad M3 ber	SI	Ø0.4 to Ø2.0 Ø0.016 to Ø0.079 approx.	10 to 30 0.394 to1.181	↓ 15		ø0.125 ø0.005	FD-R33EG, FD-EG31
	allel Zoom lens	Ø0.4 to Ø2.2 Ø0.016 to Ø0.087 approx.		ø5 ø0.197 ↑ FX-MR8		ø0.175 ø0.007	FD-R34EG
		Ø0.5 to Ø2.5 Ø0.020 to Ø0.098 approx.			FA-IVIRO	ø0.25 ø0.010	FD-R32EG, FD-EG30
e he		Ø0.8 to Ø3.5 Ø0.031 to Ø0.138 approx.				ø0.5 ø0.020	FD-R31G, FD-32G, FD-32GX, FD-42G, FD-42GW
uare				10 → 0.394 ►	FX-MR9	ø0.125 ø0.005	FD-R33EG, FD-EG31
For Square head M3 reflective fiber		ø4.0 ø0.157 approx.	0 to 30	and the same of th		ø0.175 ø0.007	FD-R34EG
	Pari	ø4.0 00.137 арргох.	0 to 1.181	ø5 ø0. <u>197</u>		ø0.25 ø0.010	FD-R32EG, FD-EG30
	=	<u> </u>		↑		ø0.5 ø0.020	FD-R31G, FD-32G, FD-32GX, FD-42G, FD-42GW

Note: Spot diameter, distance to focal point and sensing range are specified for a red LED type amplifier.

Others

Designation	Model No.	Description					
	FTP-500 (0.5m 1.641 ft)	For		FT-42	FT-43	The protective tube,	
	FTP-1000 (1m 3.281 ft)	M4		FT-42S			
Protective tube	FTP-1500 (1.5m 4.922 ft)	thread		FT-42V	V		
(For thru-beam type fiber)	FTP-N500 (0.5m 1.641 ft)	For \wp	FT-31	FD-31	made of		
,,	FTP-N1000 (1m 3.281 ft)	M3	fibers	FT-31S		noncorro- sive stain- less steel, protects the inner fiber cable from any external forces.	
	FTP-N1500 (1.5m 4.922 ft)	thread		FT-31V	V		
	FDP-500 (0.5m 1.641 ft)	For M6 thread	Applicable	FD-61	FD-61W		
	FDP-1000 (1m 3.281 ft)			FD-610			
Protective tube	FDP-1500 (1.5m 4.922 ft)			FD-618	FD-H13-FM2		
(For reflective type fiber)	FDP-N500 (0.5m 1.641 ft)	For		-D 44	ED 440		
,,	FDP-N1000 (1m 3.281 ft)	M4		FD-41 FD-41V	FD-41S V FD-41SW		
	FDP-N1500 (1.5m 4.922 ft)	thread					
Fiber bender	FB-1	The fiber bender bends the sleeve part of the fiber head at the proper radius. (Note 1)					
Universal sensor	MS-AJ1-F	Horizontal mounting type Mour		Mounting stand assemi	bly for fiber		
mounting stand (Note 2)	MS-AJ2-F	Vertical mounting type		nting type	(For M3,M4 or M6 threaded head fib		
Single-core holder	FX-AT15A	The incident light intensity may vary when using a multi-core fiber or a thin type shall bending fiber. This holder suppresses the variation in the incident light intensity. Brow					

Notes: 1) Do not bend the sleeve part of any side-view type fiber or ultra-small diameter head type fiber.

2) Refer to the universal sensor mounting stand MS-AJ series pages for details.

Protective tube Fiber bender


• FTP-🗆


• FDP-

• FB-1

Universal sensor mounting stand

Using the arm which enables adjustment in the horizontal direction, sensing can also be done from above an assembly line.

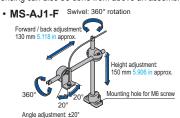

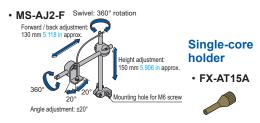

SPECIFICATIONS

			NPN output			PNP output				
	Туре	Red LED	Blue LED	Green LED	Red LED	Blue LED	Green LED			
		FX-411	FX-411B	FX-411G						
Item	Model No.	FX-412 (Note 2)	FX-412B (Note 2)	FX-412G (Note 2)	FX-411P	FX-411BP	FX-411GP			
Sup	ply voltage	12 to 24 V DC ±10 % Ripple P-P 10 % or less								
Pow	er consumption	<red led="" type=""> Normal operation: 960 mW or less (Current consumption 40 mA or less at 24 V supply voltage) ECO mode: 840 mW or less (Current consumption 35 mA or less at 24 V supply voltage) <blue green="" led="" type=""> Normal operation: 720 mW or less (Current consumption 30 mA or less at 24 V supply voltage) ECO mode: 580 mW or less (Current consumption 24 mA or less at 24 V supply voltage)</blue></red>								
Output		<npn output="" type=""> NPN open-collector transistor Maximum sink current: 100 mA (50 mA, if five, or more, amplifiers) are connected in cascade Applied voltage: 30 V DC or less (between output and 0 V) Residual voltage: 1.5 V or less (at 100 mA sink current) (50 mA, if five, or more, amplifiers) are connected in cascade Residual voltage: 1.5 V or less (at 100 mA sink current) (50 mA, if five, or more, amplifiers) are connected in cascade </npn>								
	Utilization category			DC-12 c	or DC-13					
	Output operation			Switchable either L	ight-ON or Dark-ON					
	Short-circuit protection	Incorporated								
Res	ponse time	150 µs or less (FAST), 500 µs or less (STD), 4.5 ms or less (U-LG) selectable with setting switch								
Operation indicator		Orange LED (lights up when the output is ON)								
Stab	oility indicator	Green LED (lights up under stable light received condition or stable dark condition)								
Time	er function	Incorporated with variable ON-delay / OFF-delay / ONE SHOT timer, switchable either effective or ineffective. [Timer period (Note 3): 1 ms to 3 sec. approx. (1 to 10 ms: Setting possible in units of 1 ms, 10 to 100 ms: Setting possible in units of 10 ms, 10 to 500 ms: Setting possible in units of 50 ms, 500 ms to 1 sec.: Setting possible in units of 100 ms, 1 to 3 sec.: Setting possible in units of 500 ms)								
Auton	natic interference prevention function	Incorporated (Up to four sets of fiber heads can be mounted close together. However, U-LG mode is 8 fiber heads.)(Note 4)								
	Pollution degree	3 (Industrial environment)								
ance	Ambient temperature	-10 to +55 °C -14 to +131 °F (If 4 to 7 units are connected in cascade: -10 to +50 °C +14 to +122 °F, if 8 to 16 units are connected in cascade: -10 to +45 °C +14 to +113 °F) (No dew condensation or icing allowed), Storage: -20 to +70 °C -4 to +158 °F								
siste	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH								
mental resistance	Ambient illuminance	Incandescent light: 3,000 tx or less at the light-receiving face								
men	EMC	EN 60947-5-2								
Environ	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure (Note 5)								
En	Insulation resistance	20 MΩ, or more, with 250 V DC megger between all supply terminals connected together and enclosure (Note 5)								
	Vibration resistance	10 to 150 Hz frequency, 0.75 mm 0.030 in amplitude in X, Y and Z directions for two hours each								
	Shock resistance		98 m/s² accelerati	on (10 G approx.) in 2	X, Y and Z directions t	for five times each				
Emitting element (modulated)		Red LED	Blue LED	Green LED	Red LED	Blue LED	Green LED			
	Peak emission wavelength	650 nm 0.026 mil	470 nm 0.019 mil	525 nm 0.021 mil	650 nm 0.026 mil	470 nm 0.019 mil	525 nm 0.021 mil			
Mate	erial		Enclosu	re: Heat-resistant AB	S, Case cover: Polyca	arbonate	1			
Cab	le length	Total length up to 100 m 328.084 ft (50 m 164.042 ft for 5 to 8 units, 20 m 65.617 ft for 9 to 16 units) is possible with 0.3 mm², or more, cable.								
Weig		Net weight: 20 g approx., Gross weight: 30 g approx.								
Control of the contro										

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.

2) The **FX-412** has a threshold value adjuster that can be adjusted with your fingers.

3) For models manufactured up until June 2005, the timer period is approx. 1 to 500 ms.

- 4) When the power supply is switched on, the light emission timing is automatically set for interference prevention.
 5) The voltage withstandability and the insulation resistance values given in the above table are for the amplifier only.

LASER SENSORS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS

PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Fibers

Fiber Amplifier

FX-500 FX-100

FX-300

FIBER SENSOR:

LASER SENSORS PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSORS AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

> INDUCTIVE PROXIMITY SENSORS PARTICULAR

SENSORS OPTIONS

SIMPLE WIRE-SAVING UNITS

UNITS
WIRE-SAVING
SYSTEMS

MEASURE-MENT SENSORS STATIC ELECTRICITY

STATIC ELECTRICITY PREVENTION DEVICES LASER MARKERS

PLC

HUMAN MACHINE INTERFACES ENERGY CONSUMPTION VISUALIZATION COMPONENTS

COMPONENTS

MACHINE
VISION
SYSTEMS

UV CURING SYSTEMS

Selection Guide Fibers Fiber

FX-500 FX-100 FX-300

FX-410 FX-311 FX-301-F7/ FX-301-F

I/O CIRCUIT DIAGRAMS

Color code of quick-connection cable

(Black) Output

(Black)


Notes: 1) The quick-connection sub cable does not have +V (brown) and 0 V (blue). The power is supplied from the connector of the main cable.

2) 50 mA max., if five amplifiers, or more, are connected together.

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr : NPN output transistor

FX-41□P

PNP output type

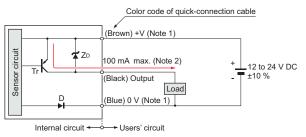

Notes: 1) The quick-connection sub cable does not have +V (brown) and 0 V (blue). The power is supplied from the connector of the main cable.

2) 50 mA max., if five amplifiers, or more, are connected together.

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode Tr : PNP output transistor

PRECAUTIONS FOR PROPER USE

Refer to p.1458~ for general precautions.



 Never use this product as a sensing device for personnel protection.

 In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

Mounting

 Make sure that the power supply is off while connecting / disconnecting the amplifiers and the quick-connection cables.


How to mount the amplifier

- ① Fit the rear part of the mounting section of the amplifier on a width DIN rail.
- ② Press down the rear part of the mounting section of the unit on the width DIN rail and fit the front part of the mounting section to the DIN rail.



How to remove the amplifier


- ① Push the amplifier forward.
- ② Lift up the front part of the amplifier to remove it.

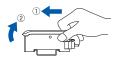

Note: Take care that if the front part is lifted without pushing the amplifier forward, the hook on the rear portion of the mounting section is likely to break.

Fiber installation


- Insert the fiber into the amplifier after attaching the attachment. Refer to the "Instruction Manual" included with the fiber for details.
- 1 Push the fiber lock lever down.
- ② Slowly insert the fiber into the insertion slot until it stops. (Note 1)
- ③ Push the fiber lock lever back up until it stops.

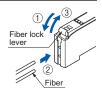

Notes: 1) Note that if the fiber is not fully inserted, the sensing distance will decrease. Also note that the flexible fiber may bend during insertion.

2) In case of coaxial reflective type fibers, mount the central fiber (single-core) to the emitter part and the peripheral fiber (multi-core) to the receiver. Note that sensing precision will deteriorate when done in reverse.

Part description

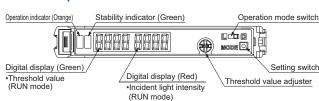

Wiring

- · Make sure that the power supply is off while wiring.
- Verify that the supply voltage variation is within the rating.
- Take care that if a voltage exceeding the rated range is applied, or if an AC power supply is directly connected, the product may get burnt or damaged.
- In case noise generating equipment (switching regulator, inverter motor, etc.) is used in the vicinity of this product, connect the frame ground (F.G.) terminal of the equipment to an actual ground.
- If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- Take care that short circuit of the load wrong wiring may burn or damage the product.
- Do not run the wires together with high-voltage lines or power lines or put them in the same raceway. This can cause malfunction due to induction.
- Extension up to total 100 m 328.084 ft (if 5 to 8 units are connected in cascade: 50 m 164.042 ft, if 9 to 16 units are connected in cascade: 20 m 65.617 ft) is possible with 0.3 mm², or more, cable. However, in order to reduce noise, make the wiring as short as possible.
- Take care that cable extension increases the residual voltage.

PRECAUTIONS FOR PROPER USE

Refer to p.1458~ for general precautions.

object

(Incident light intensity)

40 4000

(Incident light intensity)


(Threshold value)


Cascading

- Make sure that the power supply is off while adding or removing the amplifiers.
- Make sure to check the allowable ambient temperature, as it depends on the number of amplifiers connected in cascade.
- In case two, or more, amplifiers are connected in cascade, make sure to mount them on a DIN rail.
- When the amplifiers move on the DIN rail depending on the attaching condition or the amplifiers are mounted close to each other in cascade, fit them between the optional end plates (MS-DIN-E) mounted at the two ends.
- Up to maximum 15 amplifiers can be added (total 16 amplifiers connected in cascade.)
- When connecting more than two amplifiers in cascade, use the sub cable (CN-71-C□) as the quickconnection cable for the second amplifier onwards.
- When connecting amplifiers not close to each other in parallel, be sure to mount the optional end plate (MS-DIN-E) at both sides of each amplifier or affix the communication window seal of the optional fiber amplifier protection seal (FX-MB1) to the communication windows. For details, refer to the instruction manual enclosed with the FX-MB1.
- When the different LED (red / blue / green) types are connected in cascade, mount the identical models together.
- When this product is used with the other digital fiber amplifiers, be sure to place this product to the left most position (When you look from the connector side). If this product is not placed to the leftmost position, this product may not operate properly.

Cascading method


- Mount the amplifiers, one by one, on the DIN rail.
- ② Slide the amplifiers next to each other, and connect the quick-connection cables.
- ③ Mount the optional end plates (MS-DIN-E) at both the ends to hold the amplifiers between their flat sides.
- 4 Tighten the screws to fix the end plates.

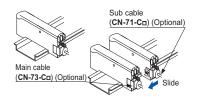

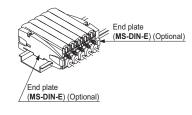

Dismantling

- ① Loosen the screws of the end plates.
- ② Remove the end plates.
- ③ Slide the amplifiers and remove them one by one.

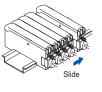

Switching output operation

 The operation selection switch can be used to display different output operations (L-ON / D-ON) on the digital display.

When set to Dark-ON (D-ON)



When set to Light-ON (L-ON)



Threshold value (sensitivity) adjustment

- ① Check the incident light intensity [in the digital display (red)] when a sensing object is placed in the sensing position.
- ② Check the incident light intensity [in the digital display (red)] when the sensing object is removed from the sensing position.
- ③ Turn the threshold value adjuster to the threshold value [in the digital display (green)] that is the value in between ① and ②. (The threshold value is automatically written to the EEPROM.)

Threshold value setting method

 When the threshold value adjuster is turned clockwise, the threshold value increases. When the threshold value adjuster is turned counterclockwise, the threshold value decreases.



 If there is a sufficient level of margin in the incident light intensity, the stability indicator (green) will light up.

Mode selection

- When the setting switch is pressed and held for 2 sec. or more, "SET" mode (mode setting screen) is activated.
- If the setting switch is pressed while in "SET" mode, the mode will change.
- If the threshold value adjuster is turned while a mode is active, the setting item will change and blink.
- When the setting switch is pressed at the item you would like to set, it blinks 3 times and then the setting is confirmed and the mode switches to the next mode.
- If the setting switch is pressed and held for 2 sec. or more or do not press any key for 15 sec. while "SET" mode is active, the mode will switch automatically to "RUN" mode.

FIBER SENSORS

LASER SENSORS

> PHOTO-ELECTRIC SENSORS

MICRO PHOTO-ELECTRIC SENSOPS

AREA SENSORS

LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC ELECTRICITY PREVENTION DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY CONSUMPTION VISUALIZATION COMPONENTS

COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Fibers

FX-500

FX-100 FX-300

FX-410

FX-311 FX-301-F7/ FX-301-F

Ramco National www.PanasonicSensors.com 1-800-280-6933

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

COMPONENTS

PRESSURE

SENSORS

SENSORS SENSOR OPTIONS

SIMPLE WIRE-SAVING LINITS

WIRE-SAVING SYSTEMS

MEASURE MENT SENSORS

LASER MARKERS

HUMAN MACHINE INTERFACES

FA COMPONENTS

MACHINE VISION SYSTEMS

FX-500

FX-100

FX-300

FX-311 FX-301-F7/

ENERG'

PLC

MICRO

PRECAUTIONS FOR PROPER USE


Refer to p.1458~ for general precautions.

<RUN condition>

Mode table

Mode	Factory setting	Description
Response time change mode	SPEd Std	The response time can be set.
Light-emitting amount selection mode (Note 1)	Pett 18881	The light-emitting amount can be switched among four levels.
Timer setting mode	dELY non	Timer settings can be selected; Without timer / OFF-delay timer / ON-delay timer / ONE SHOT timer. Also the timer period can be set.
Digital display inversion mode	burn off	The display on the digital display can be inverted.
Eco mode (Note 2)	Eco off	If no key is pressed for 20 sec. approx. while in "RUN" mode, the digital display turns off automatically. Press the setting switch or move the operation mode switch to make the display light up again. The digital display will light up when the threshold value adjuster is turned, but note that this will also cause the threshold value to change.
Peak / Bottom hold mode	Hold off	If the setting switch is pressed while "RUN" mode is active, the display will alternate between the peak hold value and the bottom hold value. (The display will refresh every 2 sec.) The display will return to normal if any operation other than threshold value setting is carried out.


Notes: 1) This mode is not incorporated in the blue LED type and green LED type. 2) While the peak / bottom hold mode is ON, the digital display is not

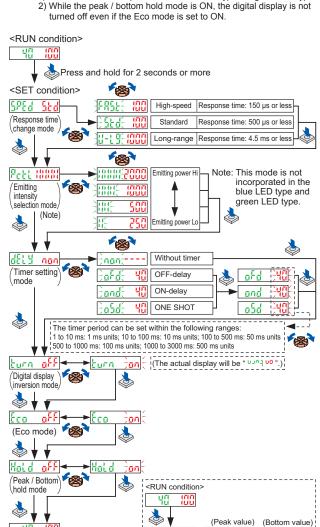

<RUN condition>

Key lock function

· When the setting switch is pressed and hold for 5 sec. while in 'RUN' mode, the key lock function can be set / canceled.

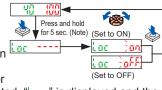

· When the key lock function is set to ON, even if the threshold value adjuster or the setting switch is operated, "Loc " is displayed and the

key operation cannot be carried out.

Note: Although the display changes to the indication of 'SET' condition 2 sec. after pressing the setting switch, keep pressing the switch. Furthermore, the sensor does not go into the key lock setting from

Factory setting

· When the setting switch is pressed and held for 10 sec., until "----" is displayed while in 'RUN' mode, the all settings are returned to the factory setting. (For the factory setting, refer to 'Mode table' in 'Mode selection'.)


Error display indicator readings


Display		Error description	Measures	
	Er- {	The load has short-circuited and excess current is flowing.	Turn off the power, then check the load.	
	£5	Communication error has occurred at time of connection.	Check if the mounted amplifiers are in close contact with each other.	

- Do not use during the initial transient time (0.5 sec.) after the power supply is switched on.
- This sensor is suitable for indoor use only.
- Do not use this sensor in places having excessive vapor, dust, etc., or where it may come in contact with corrosive
- Take care that the sensor does not come in direct contact with oil, grease, organic solvents, such as, thinner etc., or strong acid, and alkaline.
- · This sensor cannot be used in an environment containing inflammable or explosive gases.
- · Never disassemble or modify the sensor.
- The changes to the settings are written to the EEPROM, but because the EEPROM has a limited service life, you should avoid changing the settings any more than 1 million times.

DIMENSIONS (Unit: mm in)

The CAD data in the dimensions can be downloaded from our website.

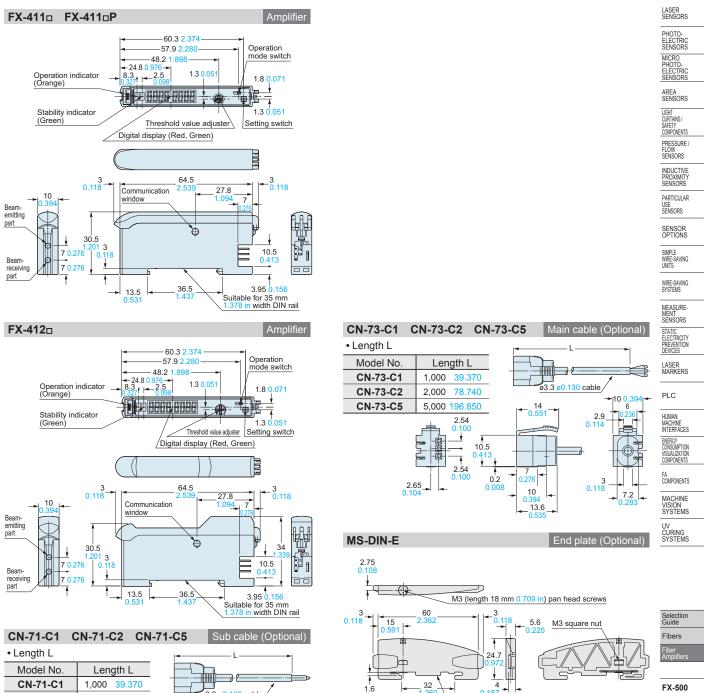

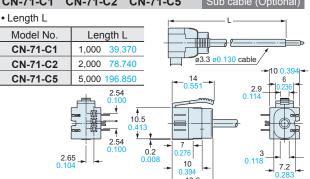


Suitable for 35 mm FX-100

FX-311

FX-301-F7/

FX-301-F

FX-300 Material: Polycarbonate FX-410

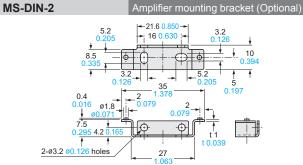

Material: Cold rolled carbon steel (SPCC) (Uni-chrome plated)