## Panasonic INDUSTRY

Got questions on laser distance sensors? Have an application but need some advice? Want to find out more about IO-LINK?

Call or email Ramco today, for full technical support - we're easy to get a hold of

CMOS type

## Micro Laser Distance Sensor

**HG-C** SERIES

HG-C1000L SERIES IO-Link Compatible, Self-monitoring Type








# Reliable detection in repeatability 10 µm 0.394 mil\*

\*HG-C1030

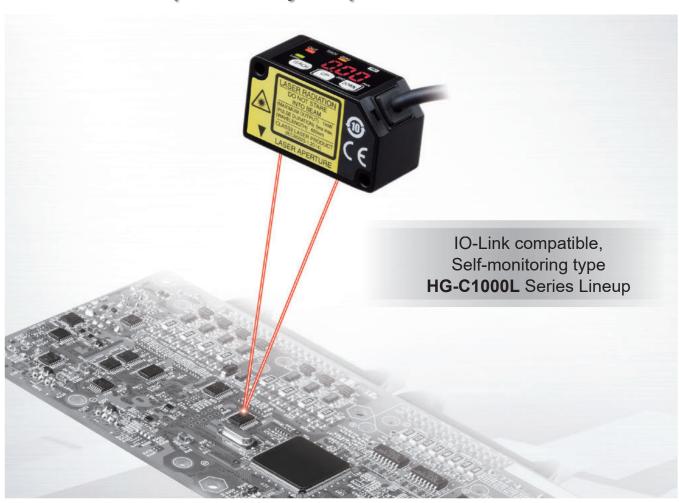

#### Repeatability

10 µm 0.394 mil \*HG-C1030

#### **Dimensions**

W20 × H44 × D25 mm WO.787 2 H1.782 2 DO.934 In

280 mm 11.024 in

Inflection resistant cable

HG-C1□0(-P) are adopted.

600 mm 23.622 in

400 mm 15.748 in

Measurement center distance: 400 mm 15.748 in Measurement range: ±200 mm 7.874 in

Measurement center distance: 200 mm.7.874 in Measurement range: ±80 mm 3.150 in

Measurement center distance: 100 mm 3.937 in Measurement range: ±35 mm 1.378 in

Measurement center distance: 50 mm 1.969 Measurement range: ±15 mm 0.591 in

Measurement center distance: 30 mm 1.181 Measurement range: ±5mm 0.197/in

200 mm 7.874 in

50 mm 1.969 in 35 mm 1.378 in 30 mm 1.181 in 25 mm 0.984 in .0 mm

HG-C1400□ HG-C1200

HG-C1100

HG-C1050

HG-C1030


Item Model No.	HG-C1030□	HG-C1050□	HG-C1100□	HG-C1200□	HG-C1400□
Measurement center distance	30 mm 1.181 in	50 mm 1.969 in	100 mm 3.937 in	200 mm 7.874 in	400 mm 15.748 in
Measurement range	±5 mm 0.197 in	±15 mm 0.591 in	±35 mm 1.378 in	±80 mm 3.150 in	±200 mm 7.874 in
Beam diameter	ø50 µm 1.969 mil approx.	ø70 μm 2.756 mil approx.	ø120 µm 4.724 mil approx.	ø300 µm 11.811 mil approx.	ø500 μm 19.685 mil approx.
Repeatability	10 µm 0.394 mil	30 μm 1.181 mil	70 µm 2.756 mil	200 μm 7.874 mil	300 µm 11.811 mil (Measuring distance 200 to 400 mm 7.874 to 15.748 in) 800 µm 31.496 mil (Measuring distance 400 to 600 mm 15.748 to 23.622 in)


# Overwhelmingly stable


Precise measurements on the order of 1/100 mm 0.0003 inch\* \*HG-C1030□


### **Excellent level detection performance**

Repeatability: 10 μm 0.394 mil \*HG-C1030

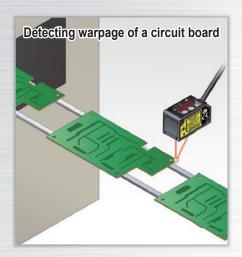

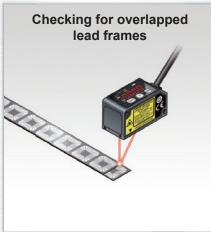

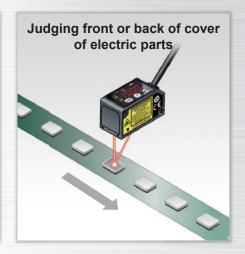


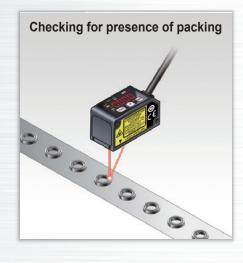



#### Fitted with a precise CMOS image sensor and an original algorithm

Thanks to a precise CMOS image sensor, it is now possible to perform highly precise measurements in the order of 1/100 mm 0.0003 in. The existing adjustable range reflective sensors cannot achieve such accuracy.

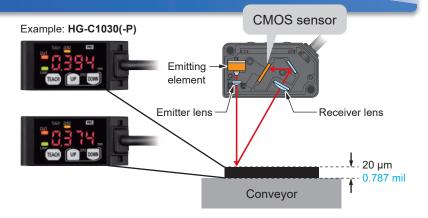



# J SERIES


#### **Indicates real measurements**


#### **Compact and**


Linearity: ±0.1% F.S. \*HG-C1030(-P) / HG-C1050(-P) / HG-C1100(-P)  $W20 \times H44 \times D25 \text{ mm } W0$ 35 g approx. (excluding

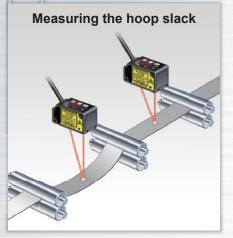


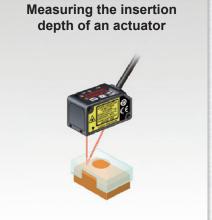

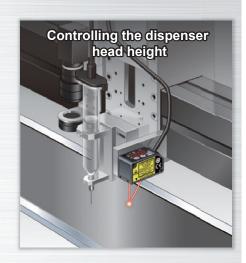

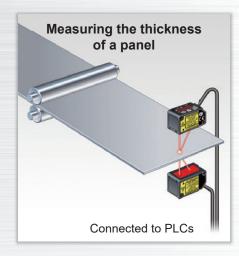

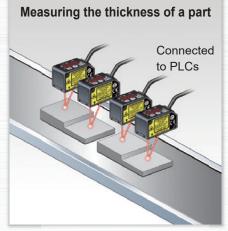

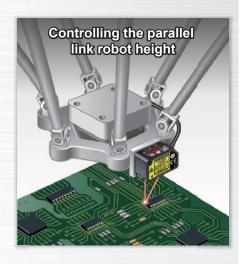

Equipped with 0 to 5 V analog output and 4 to 20 mA analog current output Excluding HG-C1000L series

The value can be measured with a distance measurement sensor.

• Linearity: ±0.1% F.S.\*


• Temperature characteristics: 0.03%F.S./°C

The sensor not only indicates measured values in mm but also produces analog outputs. Various calculations and storage (logging) can be performed when output is taken into a PLC + analog unit.

+V
0 V
External inputs
Control outputs
Analog outputs
Selectable either analog voltage output 0 to +5V or analog curroutput 4 to 20 mA
Analog ground (shielded)

• FP0R-C10 control unit (with RS232C port) AFP0RC10CRS • A/D converter unit with

 A/D converter unit with input channels (terminal block type) AFP0RAD8 \*HG-C1030(-P)/ HG-C1050(-P)/ HG-C1100(-P)
■Linearity characteristics
[Typical example: HG-C1030(-P)]

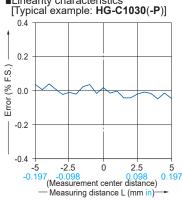

# **Compact**

The smallest CMOS laser sensor in the industry\*

\*Based on research conducted by our company as of July 2022

Measurement center distance: 400 mm


#### light-weight

#### Long distance measurement

the cable) \*HG-C1□0(-P)






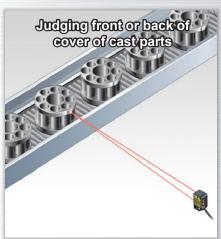



200 mm 7.874 in \*HG-C1200



achieve correct measurement.

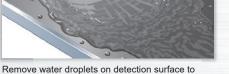

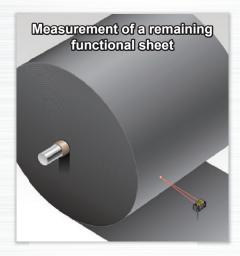


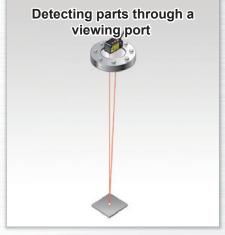

#### A new optical system with a built-in mirror

In general, more accurate and stable measurements can be obtained by increasing the optical path length between the light-receiving part and the light receiving element (CMOS), but this also increases the sensor depth and the sensor body gets bigger.

The **HG-C** series sensors incorporating a new optical system with a built-in mirror provides smaller sensor depth as well as higher measurement accuracy equivalent to displacement sensors.

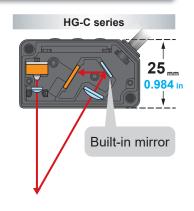

An aluminum die-cast casing protects from strain and heat

A light-weight but strong die-cast aluminum casing has been adopted. A compact, solid body casing reduces the impact of strain and heat on the measurement accuracy.

Aluminum die-cast




#### **Useful functions**

#### Teaching & window comparator mode

#### Normal sensing mode

2-Point teaching Basic teaching method

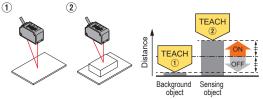


The threshold value is set automatically at the midpoint between the two points specified by teaching.

#### Limit teaching


Useful teaching method for when there is a very small object or background object.

#### < When using background object as reference >

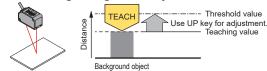

When the sensing object is located closer to the sensor than the background object, the threshold value for detection is set. This function is useful when there is a change in the size of sensing object.


#### < When using sensing object as reference >

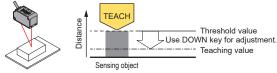

The threshold value is set on the background object side with reference to the sensing object. Use this method when there is a long distance to the background object.


#### Window comparator mode

With an object below the sensor, press the TEACH key to set the valid range for distances via threshold values. There are 3 methods for setting the valid range: 1-point, 2-point, and 3-point teaching.

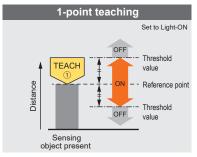


Perform 1-point teaching and the threshold range is set for the distance from the reference surface of the sensing object.

This is used for sensing within the threshold range.

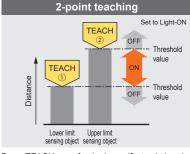

Press TEACH once for the lower (first point) and once for the upper limit (second point).

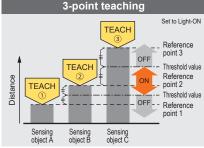


This is the method to set the threshold range by conducting the teaching at 3 points (sensing object A, B and C). After teaching, the reference points are automatically sorted in ascending order (reference point 1, 2 and 3). The thresholds are set at the midpoints between reference point 1 and 2, and 2 and 3, respectively.

Rising differential mode / Trailing differential mode

Use this mode to cancel gradual changes in the measured value and to detect only sudden changes. For the setting of threshold value, use the threshold value fine adjustment function.

#### **Timer setting function**

The time mode options are "off-delay timer," "on-delay timer," "one-shot timer" and "no timer." The counting time is fixed to 5 ms.\*

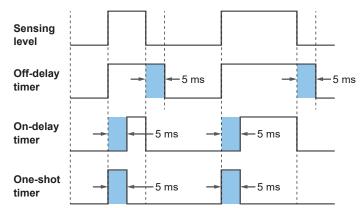

Timer period: 5 ms (fixed)

\* In the case of **HG-C1000L** series, the timer time can be changed. (See page 16)

#### Off-delay timer

Function: Extends output signals by 5 ms.

Usage: Appropriate in case a connected device is slow to respond and ON time is required to extend.

#### On-delay timer

Function: Overrides output signals for 5 ms after detection.
Usage: Convenient way to override temporary signals and control with a time lag.

#### One-shot timer

Function: Sends output signals for only 5 ms after detection.

Usage: Useful when the signal duration needs to be constant to meet inputs from a connected device.

This mode is also used to extend temporary signals by a desired length of time.

#### Zero set function

This function compulsorily sets the measured value to "zero." The zero point can be set at a desired value. It is useful when measuring steps or tolerance with reference to the height of a sensing object.




Keep pressing both keys for 3 seconds.

- \* The zero set indicator (yellow) will turn ON while the zero set is valid
- \* When the zero set function is executed while the peak hold function or the bottom hold function is valid, the held measurement value is reset
- \* When the display setting is set to offset, the zero set function cannot be set


#### **External input setting function** Excluding HG-C1000L series

One of four functions, "zero setting function," "teaching function," "emission stopping function" and "trigger function" can be assigned to an external input line.

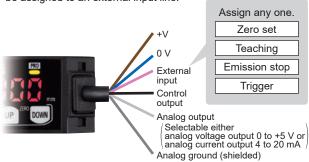


#### **Display setting function**

How to indicate measured values of the moving sensed object can be chosen from three options, "Normal," "Invert" and "Offset."

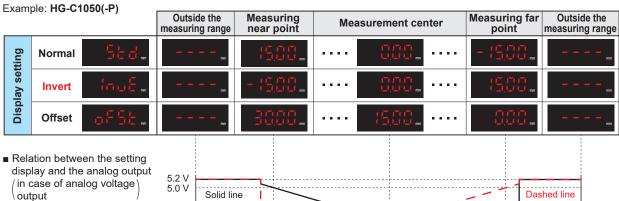

in case of analog current output

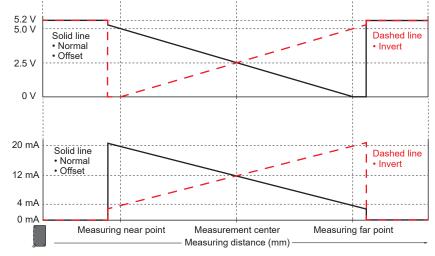

#### Peak and bottom hold functions

The peak hold function holds the maximum measured value which is output and displayed.

The bottom hold function holds the minimum measured value which is output and displayed.

- \* The peak hold function and the bottom hold function cannot be set at the same time.
- \* When the zero set function is executed while the peak hold function or the bottom hold function is valid, the held measurement value is reset

#### Threshold value fine adjustment function

Fine adjustment of threshold values can be performed while measurement is proceeding on the display, and even after teaching.

#### **Key lock function**

This function protects setting conditions from unintentional changes.

<sup>\*</sup> For other functions and procedures for setting the functions, see the instruction manual provided with the product.

## Reduction of the data analysis burden - one small step towards IoT.

IO-Link Compatible, Self-monitoring type | HG-C1000L SERIES | Self-Monitoring Sensor

**IO-Link compatible** 


Collecting sensor level data

Field data collected and accumulated for "preventive maintenance" and "operation monitoring".


An analysis of such field data requires high-level know-how and time, causing a burden to people responsible for the production site management.

The Self-Monitoring Sensor manufactured by Panasonic is capable of reporting sensor data and its own state to the host device through the I/O Link master.

With the Self-Monitoring Sensor, you can immediately judge the state of the sensor and easily identify the cause of failure. Thus, this sensor contributes to the reduction of the burden experienced by the client in collecting and analyzing data.

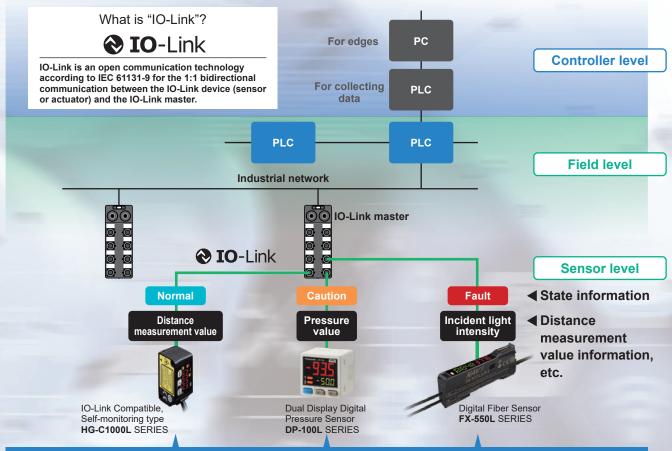


With the Panasonic's Self-Monitoring Sensor, you can leave the sensor to diagnose its own state!

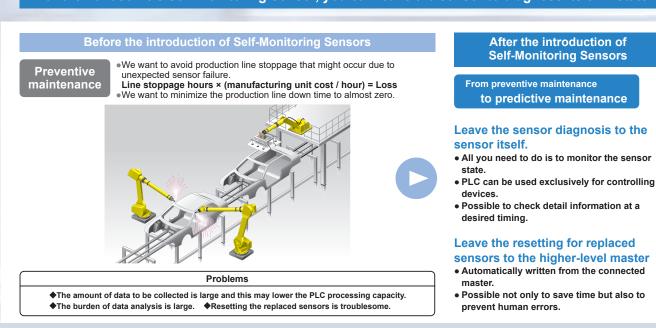

#### **Incorporated self-monitoring function**

#### With the Panasonic's Self-Monitoring Sensor, you can get high-level solutions!

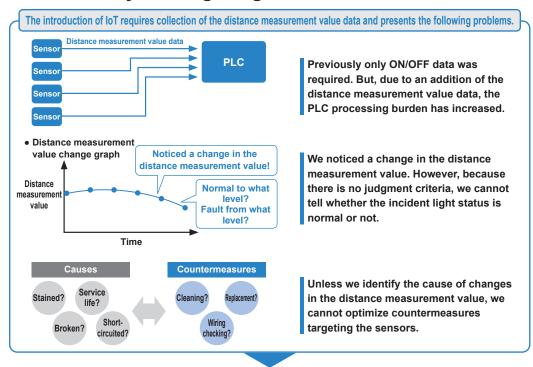


#### Problems are solved by the Self-monitoring function.

#### **Self-monitoring function**

A sensor with a self-monitoring function diagnoses its own state and notifies when readjustment of settings / setup is required or when maintenance is needed.

The sensor determines its status and indicates "Normal," "Notification," "Caution" or "Fault." When not in normal status, the sensor checks the cause of problem and corrective measure, thus reducing equipment downtime and maintenance workload.

#### Self-monitoring function: Four types of status indication and judgment of state

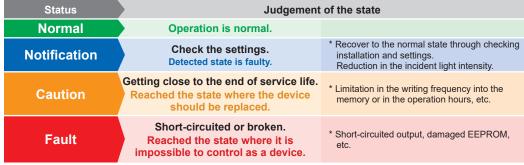

<sup>\*</sup> By creating a program with a PLC, etc., the "State" of the self-monitoring sensor can be grasped.

#### Easy use of IoT

lonitoring distance neasurement value Analyzing and making judgmen Burden imposed Identifying the cause on users Monitoring Taking ountermeasures

"Predictive maintenance" can be easily achieved through monitoring the state of the Self-Monitoring Sensor.

#### ORDER GUIDE

Type	Appearance	Measurement center distance and	Repeatability	Beam diameter	Model No.	
Туре	Appearance	measurement range	Переатарііту	(Note)	NPN output	PNP output
Measurement center 30 mm 1.181 in type		30 ± 5 mm 1.181 ± 0.197 in	10 μm 0.394 mil	ø50 µm 1.969 mil approx.	HG-C1030	HG-C1030-P
Measurement center 50 mm 1.969 in type		50 ± 15 mm 1.969 ± 0.591 in	30 μm 1.181 mil	ø70 μm 2.756 mil approx.	HG-C1050	HG-C1050-P
Measurement center 100 mm 3.937 in type	***************************************	100 ± 35 mm 3.937 ± 1.328 in	70 μm 2.756 mil	ø120 µm 4.724 mil approx.	HG-C1100	HG-C1100-P
Measurement center 200 mm 7.874 in type		200 ± 80 mm 7.874 ± 3.150 in	200 μm 7.874 mil	ø300 µm 11.811 mil approx.	HG-C1200	HG-C1200-P
Measurement center 400 mm 15.748 in type		400 ± 200 mm 15.748 ± 7.874 in	300 µm 11.811 mil (Measuring distance 200 to 400 mm 7.874 to 15.748 in) 800 µm 31.496 mil (Measuring distance 400 to 600 mm 15.748 to 23.622 in)	ø500 µm 19.685 mil approx.	HG-C1400	HG-C1400-P

Note: This is the size in the measurement center distance. These values were defined by using 1/e² (13.5 % approx.) of the center light intensity. Due to leak light outside the specified area, the reflectance around the detecting point may be higher than at the point and this may affect the measurement value.

#### IO-Link compatible, Self-monitoring type HG-C1000L series

	Туре	Appearance	Measurement center distance and measurement range	Repeatability	Beam diameter (Note)	Model No.	Control output
	Measurement center 30 mm 1.181 in type		30 ±5 mm 1.181 ±0.197 in	10 μm 0.394 mil	ø50 µm 1.969 mil approx.	HG-C1030L3-P	
/be	Measurement center 50 mm 1.969 in type		50 ±15 mm 1.969 ±0.591 in	30 μm 1.181 mil	ø70 μm 2.756 mil approx.	HG-C1050L3-P	
Discrete wire	Measurement center 100 mm 3.937 in type		100 ±35 mm 3.937 ±1.328 in	70 μm 2.756 mil	ø120 μm 4.724 mil approx.	HG-C1100L3-P	
	Measurement center 200 mm 7.874 in type		200 ±80 mm 7.874 ±3.150 in	200 μm 7.874 mil	ø300 µm 11.811 mil approx.	HG-C1200L3-P	
	Measurement center 400 mm 15.748 in type		400 ±200 mm 15.748 ±7.874 in	300 µm 11.811 mil (Measuring distance 200 to 400 mm 7.874 to 15.748 in) 800 µm 31.496 mil (Measuring distance 400 to 600 mm 15.748 to 23.622 in)	ø500 µm 19.685 mil approx.	HG-C1400L3-P	PNP open-
	Measurement center 30 mm 1.181 in type		30 ±5 mm 1.181 ±0.197 in	10 µm 0.394 mil	ø50 µm 1.969 mil approx.	HG-C1030L3-P-J	collector transistor
hype	Measurement center 50 mm 1.969 in type	9	50 ±15 mm 1.969 ±0.591 in	30 μm 1.181 mil	ø70 μm 2.756 mil approx.	HG-C1050L3-P-J	
412 connect	Measurement center 100 mm 3.937 in type	Supports Smartclick (Note 2)	100 ±35 mm 3.937 ±1.328 in	70 μm 2.756 mil	ø120 μm 4.724 mil approx.	HG-C1100L3-P-J	
	Measurement center 200 mm 7.874 in type		200 ±80 mm 7.874 ±3.150 in	200 μm 7.874 mil	ø300 µm 11.811 mil approx.	HG-C1200L3-P-J	
	Measurement center 400 mm 15.748 in type		400 ±200 mm 15.748 ±7.874 in	300 µm 11.811 mil (Measuring distance 200 to 400 mm 7.874 to 15.748 in) 800 µm 31.496 mil (Measuring distance 400 to 600 mm 15.748 to 23.622 in)	ø500 μm 19.685 mil approx.	HG-C1400L3-P-J	

Notes: 1) This is the size in the measurement center distance. These values were defined by using 1/e² (13.5 % approx.) of the center light intensity. Due to leak light outside the specified area, the reflectance around the detecting point may be higher than at the point and this may affect the measurement value.

#### **OPTIONS**

Designation	Model No.	Description
Simple mounting bracket (Note)	MS-HG-01	Foot angled mounting bracket

Note: Due to the simple mounting bracket, the sensing characteristics may not be hold depending on the installation condition, in case of the purposes for acquiring the displacement data and a fine

#### Recommended extension cables for M12 connector type

Manufactured by OMRON Corporation Extension cable with connectors on both ends XS5W series Smartclick



#### Simple mounting bracket

• MS-HG-01



Material: Stainless steel (SUS304)

Two M3 (length 25 mm 0.984 in) screws with washers (SPCC) are attached.

<sup>2)</sup> Smartclick is a trademark of OMRON Corporation.

#### **SPECIFICATIONS**

ment center 5.748 in type		Measurement center 200 mm 7.874 in type	Measurement center 100 mm 3.937 in type	Measurement center 50 mm 1.969 in type	Measurement center 30 mm 1.181 in type	Туре				
C1400	HG-C14	HG-C1200	HG-C1100	HG-C1050	HG-C1030	일 NPN output				
C1400-P	HG-C14	HG-C1200-P	HG-C1100-P	HG-C1050-P	HG-C1030-P	NPN output PNP output	Item			
		Applicable regulations and certifications								
n 15.748 in	400 mm 1	200 mm 7.874 in	100 mm 3.937 in	50 mm 1.969 in	30 mm 1.181 in	urement center distance	Measur			
ım 7.874 in	±200 mm	±80 mm 3.150 in	±35 mm 1.328 in	±15 mm 0.591 in	±5 mm 0.197 in	urement range	Measurement range			
11.811 mil ring distance 17.874 to 15.748 in) 31.496 mil ring distance 15.748 to 23.622 in)	(Measuring of 200 to 400 mm 7.87 800 µm 31 (Measuring of	200 μm 7.874 mil	70 μm 2.756 mil	30 μm 1.181 mil	10 μm 0.394 mil	atability	Repeata			
2 % F.S. ring distance 17.874 to 15.748 in) 3 % F.S. ring distance 15.748 to 23.622 in)	(Measuring of 200 to 400 mm 7.87 ±0.3 % (Measuring of Measuring of Mea	±0.2 % F.S.		±0.1 % F.S.		rity	Linearit			
			0.03 % F.S./°C			erature characteristic	Temper			
nm 0.026 mil	ength: 655 nm	nW, emission peak wave	A (Note 2)] Max. output: 1	r Class 2 [JIS/IEC/GB/FD/	Red semiconductor lase	source	Light so			
n 19.685 mil oprox.		ø300 µm 11.811 mil approx.	ø120 μm 4.724 mil approx.	ø70 μm 2.756 mil approx.	ø50 µm 1.969 mil approx.	n diameter (Note 3)	Beam d			
		% or less	DC ±10 %, Ripple P-P 10	12 to 24 V	Supply voltage					
	ge)	s (at 12 V DC supply volta	pply voltage), 65 mA or les	mA or less (at 24 V DC su	40 ı	r consumption	Power of			
<npn output="" type=""> NPN output type&gt; NPN open-collector transistor <ul> <li>Maximum sink current: 50 mA</li> <li>Applied voltage: 30 V DC or less (Between control output to 0V)</li> <li>Residual voltage: 1.5 V or less (At 50 mA sink current)</li> <li>Leakage current: 0.1 mA or less</li> </ul> PNP output type&gt; <ul> <li>Maximum source current: 50 mA</li> <li>Applied voltage: 30 V DC or less (Between control output to +V)</li> <li>Residual voltage: 1.5 V or less (At 50 mA source current)</li> <li>Leakage current: 0.1 mA or less</li> </ul></npn>						Control output				
		r Dark-ON	between either Light-ON	Switchable		utput operation	Out			
		<del>)</del>	corporated (Auto reset typ	In		hort-circuit protection	Sho			
	ı: 0 mA)	ent output ange: 4 to 20 mA (at alarr pedance: 300 Ω or less			Analog vo tage output  Output range: 0 to + Output impedance:	og output	Analog			
		/ 10 ms	ble between 1.5 ms / 5 ms	Switcha		onse time	Respon			
		tput type> n-contact input conditions d: 0 to +0.6 V DC or Ope +4 to +V DC impedance: 10 kΩ appro	PNP no • Input Inval Valid	output type> non-contact input ut conditions alid: +8 to +V DC or Open id: 0 to +1.2 V DC ut impedance:10 kΩ appro	NPN • Inp Inv Val	nal input	Externa			
			2			ion degree	Pollutio			
			2,000 m 6561.680 ft or less	2		ating altitude	Operati			
			IP67 (IEC)			Protection	g F			
°F	-4 to 140 °F	d), Storage: -20 to +60 °C	ondensation or icing allowe	C -14 to 113 °F (No dew co	-10 to +45 °C	Ambient temperature	sistar			
	Ambient humidity	n res								
	Ambient illuminance	Ambient illuminance								
urs each	Vibration resistance									
		rections three times each	G approx.) in X, Y and Z	500 m/s <sup>2</sup> acceleration (50		Shock resistance	Env			
		7 ft long	omposite cable, 2 m 6.561	5-core c			Cable			
		0.3 mm², or more, cable.	n 32.808 ft is possible with	Extension up to total 10 n		extension	Cable e			
		over: Acrylic	Aluminum die-cast, Front c	Enclosure: A		ial	Materia			
		orox. (including cable)	ox. (without cable), 85 g ap	Net weight: 35 g appro		ht	Weight			
	for two hou	% RH ht-receiving face e in X, Y and Z directions rections three times each 7 ft long 0.3 mm², or more, cable. over: Acrylic	to 5 % RH, Storage: 35 to 85 at: 3,000 & or less at the lique of 0.059 in double amplitude G approx.) in X, Y and Z domposite cable, 2 m 6.561 as 2.808 ft is possible with Aluminum die-cast, Front composite cable, 2 m 6.561	35 to 8  Incandescent light: 1 min.) frequency, 1.5 min. 500 m/s² acceleration (50 5-core content in the state of the stat	10 to 55 Hz (period	Ambient humidity  Ambient illuminance  Vibration resistance  Shock resistance  e extension	Cable e			

Notes: 1) Supply voltage: 24 V DC, ambient temperature: +20 °C +68 °F, response time: 10 ms, and analog output value of measurement center distance are

1) Supply Voltage. 24 V DC, all bleft temperature. 420 C 406 F, response time. To first, and alraing output value of measurement center distance are used for unspecified measurement conditions. The subject is white ceramics.
 2) This product complies with 21 CFR 1040.10 and 1040.11 Laser Notice No. 50, dated June 24, 2007, issued by CDRH (Center for Devices and Radiological Health) under the FDA (Food and Drug Administration).
 3) This is the size in the measurement center distance. These values were defined by using 1/e² (13.5 % approx.) of the center light intensity. Due to leak light outside the specified area, the reflectance around the detecting point may be higher than at the point and this may affect the measurement value.

#### **SPECIFICATIONS**

#### IO-Link compatible, Self-monitoring type HG-C1000L series

		Туре	Measurement center 30 mm 1.181 in type	Measurement center 50 mm 1.969 in type	Measurement center 100 mm 3.937 in type	Measurement center 200 mm 7.874 in type	Measurement center 400 mm 15.748 in type			
`	\ _{2}	Discrete wire	HG-C1030L3-P	HG-C1050L3-P	HG-C1100L3-P	HG-C1200L3-P	HG-C1400L3-P			
Item	ON loboM	M12 connector	HG-C1030L3-P-J	HG-C1050L3-P-J	HG-C1100L3-P-J	HG-C1200L3-P-J	HG-C1400L3-P-J			
Applicable regulations and certifications  CE Marking (EMC Directive, RoHS Directive), FDA Regulations, UL/c-UL Certification					ation					
Meas	suremen	t center distance	30 mm 1.181 in	50 mm 1.969 in	100 mm 3.937 in	200 mm 7.874 in	400 mm 15.748 in			
Meas	suremen	t range	±5 mm 0.197 in	±15 mm 0.591 in	±35 mm 1.328 in	±80 mm 3.150 in	±200 mm 7.874 in			
Repeatability			10 μm 0.394 mil	30 μm 1.181 mil	70 μm 2.756 mil	200 μm 7.874 mil	300 µm 11.811 mil (Measuring distance 200 to 400 mm 7.874 to 15.748 in) 800 µm 31.496 mil (Measuring distance 400 to 600 mm 15.748 to 23.622 in)			
Linearity				±0.1 % F.S.			±0.2 % F.S. (Measuring distance 200 to 400 mm 7.874 to 15.748 in) ±0.3 % F.S. (Measuring distance 400 to 600 mm 15.748 to 23.622 in)			
Temp	perature	characteristic			0.03 % F.S./°C					
Light	source		Red semiconductor laser	Class 2 [IEC / JIS / GB / F	DA (Note 2)] Max. output:	1 mW, emission peak wave	elength: 655 nm 0.026 mil			
Bear	n diamet	er (Note 3)	ø50 µm 1.969 mil approx	ø70 µm 2.756 mil approx.	ø120 μm 4.724 mil approx.	ø300 µm 11.811 mil approx.	ø500 µm 19.685 mil approx.			
Supp	oly voltag	e		24 '	V DC ±10 % Ripple P-P 1	0 %				
Powe	er consu	mption		40 mA c	r less (at 24 V DC supply voltage)					
		IO-Link communication	IO-Link Specification V1.1							
	nunication t (C/Q)	Baud rate	COM3 (230.4 kbps)							
(Note		Process data	4 byte							
		Minimum cycle time	1.0 ms							
Cont	rol outpu	it (DO)	PNP open-collector transistor  • Maximum source current: 50 mA  • Applied voltage: 30 V DC or less (Between control output to +V)  • Residual voltage: 1.5 V or less (at 50 mA source current)  • Leakage current: 0.1 mA or less							
	Output	operation		Switchable	between either Light-ON	or Dark-ON				
	Short-ci	rcuit protection		In	corporated (auto reset typ	e)				
Resp	onse tim	ne		Switcha	ble between 1.5 ms / 5 ms	s / 10 ms				
Pollu	ition deg	ree			2					
Amb	ient altitu	ıde		2	2,000 m 6561.680 ft or less	s				
ээс	Protecti	on	IP67 (IEC)							
sistaı	Ambien	t temperature	-10 to +45 °C -14 to 113 °F (No dew condensation or icing allowed), Storage: -20 to +60 °C -4 to 140 °F							
al res	Ambien	t humidity	35 to 85 % RH, Storage: 35 to 85 % RH							
Environmental resistance	Ambien	t illuminance	Incandescent light: 3,000 ℓx or less at the light-receiving face							
iron	Vibratio	n resistance	10 to 55 Hz (period	: 1 min.) frequency, 1.5 m	m 0.059 in double amplitud	de in X, Y and Z directions	s for two hours each			
Env	Shock r	esistance		500 m/s <sup>2</sup> acceleration (50	G approx.) in X, Y and Z o	directions three times each	1			
Cabl	е				-core PVC cable, 2 m 6.56 4-core PVC cable with co		ng			
Cabl	e extens	ion		Extension up to total 20 n	n 65.617 ft is possible with	0.3 mm <sup>2</sup> , or more, cable.				
Mate	rial		Enclosure: Aluminum die-cast, Front cover: Acrylic							
Weig	ıht				prox. (without cable), 80 g approx. (without cable), 50					


Notes: 1) Supply voltage: 24 V DC, ambient temperature: +20 °C +68 °F, response time: 10 ms, and analog output value of measurement center distance are used for unspecified measurement conditions. The subject is white ceramics.

2) This product complies with 21 CFR 1040.10 and 1040.11 Laser Notice No. 50, dated June 24, 2007, issued by CDRH (Center for Devices and Radiological Health) under the FDA (Food and Drug Administration).

<sup>3)</sup> This is the size in the measurement center distance. These values were defined by using 1/e² (13.5 % approx.) of the center light intensity. Due to leak light outside the specified area, the reflectance around the detecting point may be higher than at the point and this may affect the measurement value.

4) When the sensor is used as an ordinary sensor, the communication output (C/Q) provides the same output operation as the control output (DO).

#### I/O CIRCUIT AND WIRING DIAGRAMS

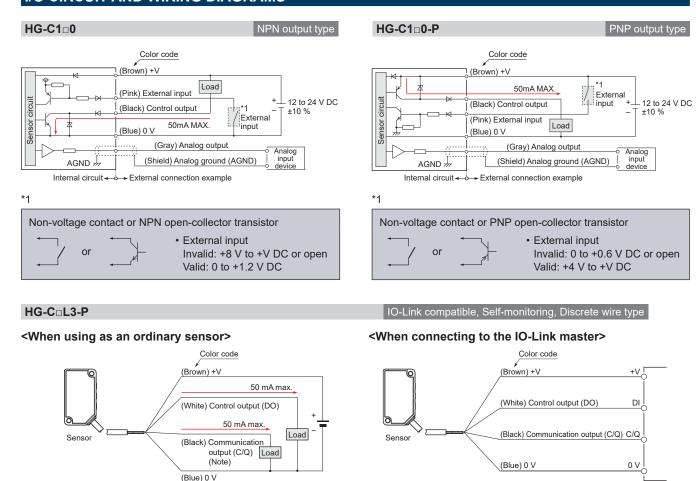


Note: When the sensor is used as an ordinary sensor, the communication output (C/Q) provides the same output operation as the control output (DO).

#### HG-C<sub>2</sub>L3-P-J

#### IO-Link compatible, Self-monitoring, M12 connector type


#### <When using as an ordinary sensor>

#### <When connecting to the IO-Link master>

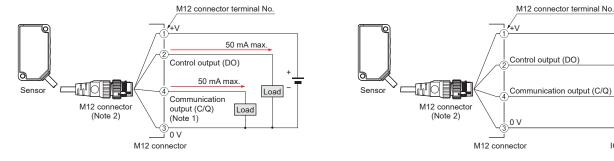

Notes: 1) When the sensor is used as an ordinary sensor, the communication output (C/Q) provides the same output operation as the control output (DO). 2) When wiring with the discrete wire or extending the cable from the M12 connector, separately prepare commercially available M12 connector cable.

#### M12 connector terminal arrangement diagram

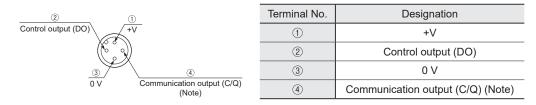

Note: When the sensor is used as an ordinary sensor, the communication output (C/Q) provides the same output operation as the control output (DO).

IO-Link master

DI

C/Q


0 V


IO-Link master


M12 connector terminal No.


#### **SENSING CHARACTERISTICS (TYPICAL)**


#### Linearity

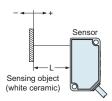


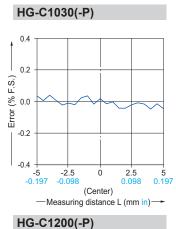

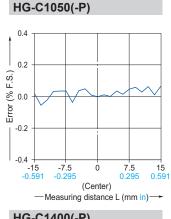

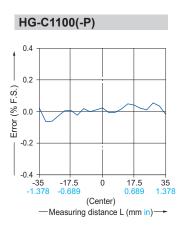

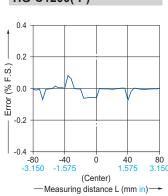

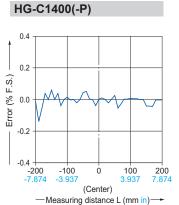

#### PRECAUTIONS FOR PROPER USE

• This catalog is a guide to select a suitable product. Be sure to read instruction manual attached to the product prior to its use.



 Never use this product as a sensing device for personnel protection.

· In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.




 Do not operate products using methods other than the ones described in the instruction manual included with each product. Control or adjustment through procedures other than the ones specified may cause hazardous laser radiation exposure

- · This product is classified as a Class 2 Laser Product under JIS / IEC / GB standards and FDA \* regulations. Do not look at the laser beam directly or through an optical system such as a lens.
- The warning label (English) is attached to the product. Handle the product according to the instruction given on the warning label. (The warning labels in Japanese and Chinese are packed with the sensor.)



\*This product complies with 21 CFR 1040.10 and 1040.11 Laser Notice No. 50, dated June 24, 2007, issued by CDRH (Center for Devices and Radiological Health) under the FDA (Food and Drug Administration).


#### Part description

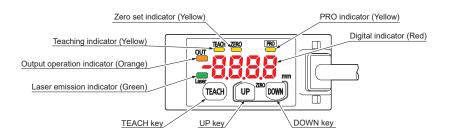


#### PRECAUTIONS FOR PROPER USE

#### Mounting

• When mounting this product, use M3 screws. The tightening torque should be 0.5 N·m. Please prepare M3 screws separately.

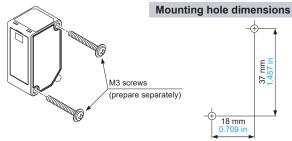

• When mounting the simple mounting bracket (optional) on this product, the tightening torque should be 0.5 N·m or less.

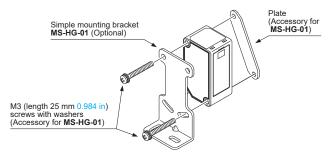


Note: Due to the simple mounting bracket, the sensing characteristics may not be hold depending on the installation condition, in case of the purposes for acquiring the displacement data and a fine detecting.

#### Mounting direction

Direction to a movable body


#### <When there are differences in material and color>

· When performing measurements of moving objects with excessively different materials and colors, mount the product per the following directions to minimize measurement errors.

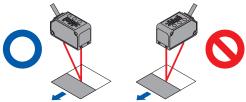


#### <Measurement of rotating objects>

· When measuring rotating objects, mount the product as follows. Measurement can be performed with minimized effect on the object caused by up / down deflection, position deviation and etc.

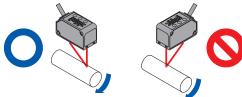


#### <When there is a step>

· When there is a step in the moving object, mount the product as follows. Measurement can be performed with minimized effect from the edges of the steps.

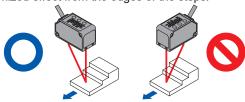

#### Measuring of narrow locations and recesses

 When measuring in narrow locations or inside holes, mount the product so that optical path from the lightemitting part to light-receiving part is not interrupted.

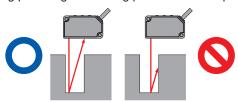

#### · When mounting the product on a wall

• Mount the product as follows, so that the multiple light reflections on the wall do not emit to the light-receiving part. When the reflection factor on a wall is high, it is effective to use a dull black color.



#### **Others**


- This product has been developed / produced for industrial use only.
- Make sure that the power supply is OFF before starting the wiring.
- If the wiring is performed incorrectly, it will cause a failure.
- Do not run the wires together with high-voltage lines or power lines, or put them in the same raceway. This can cause malfunction due to induction.
- · Verify that the supply voltage variation is within the rating.
- · If power is supplied from a commercial switching regulator, ensure that the frame ground (F.G.) terminal of the power supply is connected to an actual ground.
- · If noise generating devices (switching regulators, inverter motors, etc.) are used around the sensor mounting area, make sure to connect the frame ground (FG) terminal of the device.
- Do not use this product during the transient state when the power supply is turned ON.
- The overall length of the cable can be extended to 10 m 32.808 ft maximum (HG-C1000L series: 20 m 65.617 ft maximum) with a cable size of 0.3 mm<sup>2</sup> or more.
- · Make sure that stress by forcible bend or pulling is not applied to the sensor cable joint.
- Although it depends on the type, light from rapid start type or high frequency lighting type fluorescent lights, sunlight and etc. may affect the sensing, therefore make sure to prevent direct incident light.
- · This product is suitable for indoor use only.
- Keep water, oil, fingerprints and etc. which reflect light, or dust, particles or etc. which interrupts the light, away from the emitting / receiving surfaces of this product. If contaminants adhere to the surface, wipe off with a dust-free soft cloth, or lens cleaning paper.
- Do not use the sensor in locations where there is excessive vapor, dust or etc. or in an atmosphere where corrosive gases, etc. is generated.
- Take care that the product does not come in contact with oil, grease, organic solvents such as thinner, etc., strong acid or alkaline.
- · Make sure to turn OFF the power supply, before cleaning the light emitting / receiving windows of the sensor head.
- There is a certain deviation in the directionality of this product. Install the product using a mounting bracket or similar fitting to allow the adjustment of optical axis.
- The internal memory (nonvolatile) of this product has a service life. Settings cannot be configured more than 100,000 times.

#### PRECAUTIONS FOR PROPER USE

#### **PRO** mode setting

#### Part description

PRO indicator (Yellow)

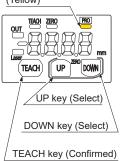

Item	Default setting	Description
Response time setting	Hr5a	Set the response time.  "H-50":High precision 10 ms, " 550": Standard 5 ms, "FR52": High speed 1.5 ms
Output operation setting	Lion	Select the control output operation mode. " ¿ - on ": Light-ON, " d - on ": Dark-ON
Sensing output setting		Set the sensing output.  "
Analog output setting [excluding HG-C1000L series]	Jolie	Set the output operation of analog output setting. " <u>นอใใ</u> ใ ": Analog voltage output (0 to +5 V) " ใจใใ ": Analog current output (4 to 20 mA)
Hysteresis setting	<hg-c1030 <hg-c1100="" <hg-c1400="" <hg-c1400<="" td=""><td>Set the hysteresis width.  HG-C1030□: 0.001 to 5.00 mm 0.00004 to 0.197 in  HG-C1050□: 0.01 to 15.00 mm 0.00039 to 0.591 in  HG-C1100□: 0.02 to 35.00 mm 0.00079 to 1.378 in  HG-C1200□: 0.1 to 80.0 mm 0.00394 to 3.150 in  HG-C1400□: 0.2 to 200.0 mm 0.00787 to 7.874 in</td></hg-c1030>	Set the hysteresis width.  HG-C1030□: 0.001 to 5.00 mm 0.00004 to 0.197 in  HG-C1050□: 0.01 to 15.00 mm 0.00039 to 0.591 in  HG-C1100□: 0.02 to 35.00 mm 0.00079 to 1.378 in  HG-C1200□: 0.1 to 80.0 mm 0.00394 to 3.150 in  HG-C1400□: 0.2 to 200.0 mm 0.00787 to 7.874 in
External input setting [excluding HG-C1000L series]	0586	Set the external input.  " USEL ": Zero set function, " LECH": Teaching function  " L-oF": Light emitting stop function, " L- 13": Trigger function
Shift amount setting for <b>HG-C1000L</b> series only	<hg-c1030l3-p> <hg-c1050l3-p> <hg-c1100l3-p> <hg-c1200l3-p> <hg-c1400l3-p> <hg-c1400l3-p></hg-c1400l3-p></hg-c1400l3-p></hg-c1200l3-p></hg-c1100l3-p></hg-c1050l3-p></hg-c1030l3-p>	Set the shift amount for the threshold value when using limit teaching.  Be sure to set the shift amount to a value twice the hysteresis setting value or higher.  HG-C1030L3-P□: 0.002 to 10.00 mm 0.00008 in to 0.394 in HG-C1050L3-P□: 0.02 to 30.00 mm 0.00079 in to 1.181 in HG-C1100L3-P□: 0.04 to 70.00 mm 0.00157 in to 2.756 in HG-C1200L3-P□: 0.2 to 160.0 mm 0.00787 in to 6.299 in HG-C1400L3-P□: 0.4 to 400.0 mm 0.01575 in to 15.748 in
Timer setting	non	Set the timer operation. The timer time is fixed at 5ms.  " non": No timer, " oFd": OFF-delay timer  " ond": ON-delay timer, " o5d": One-shot timer
Timer period setting for HG-C1000L series only	5	Set the timer period when the timer setting is set to "off-delay timer," "on-delay timer" or "one-shot timer."  " 5": 5 ms, " (0": 10 ms, " 25": 25 ms,  " 50": 50 ms, " (000": 1,000 ms, " 5000": 5,000 ms
Display setting	55 <i>a</i>	The display of the measured value can be changed.  " 5೬៨": Normal, " lout ": Invert," oF5೬ ": Offset
Hold setting	oFF	Set the control output and the analogue output operation when a measurement error occurs (insufficient light intensity, saturation of light intensity, out of measurement range). "   ### F ": Hold OFF, "   ### ": Hold ON
ECO setting	oFF	The digital display can be set to go OFF when key operation is not performed for 30 seconds. Current consumption can be reduced.  " oFF ": ECO OFF, " on ": ECO ON
Reset setting	no	Return to the default setting (factory setting).  " "Reset NG, " 455": Reset OK

#### PRECAUTIONS FOR PROPER USE

#### **Error indication**

• In case of errors, attempt the following measures.

Error indication	Description	Remedy	
<hold off=""> <hold on=""> Measured value blinks</hold></hold>	Insufficient amount of reflected light. The sensing object is out of the sensing range.	Confirm that the sensing distance is within the specification range. Adjust the installation angle of the sensor.	
E-0:	Nonvolatile memory is damaged or is past its life expectancy.	Please contact our office.	
E- 11	Load of the sensing output is short-circuited causing an over-current to flow.	Turn OFF the power and check the load.	
8-21	The semiconductor laser is damaged or is past its life expectancy.	Please contact our office.	
8-31	When zero set is set, the measurement is not performed normally.     Since the display setting is set to "Offset", the zero set function can not be used.	Confirm that the sensing distance is within the specification range. Set the display to any setting except "Offset."	
EHM 1	During teaching, the measurement is not performed normally.	Confirm that the sensing distance is within the specification range.	
6-90 6-91 6-93 6-93	System error	Please contact our office.	

#### **Event function (HG-C1000L series)**


Error indication	Event code	Error level	State
Er 11	0x7710	Fault	DO output short-circuit
8485 8483 8480 8481	0x1815	Fault	System error
8604	0x1802	Fault	Nonvolatile memory write error
8601	0x1803	Fault	Nonvolatile memory CRC error
8n2 t	0x1810	Fault	Light emission circuit damage
8631	0x8CB0	Notification	Zero set not possible
E-41	0x8CB2	Notification	Teaching not possible
	0x8CA0	Notification	Measurement error (center of gravity computation failure)  * Measured value: Transmission of 32764
	0x8CA1	Notification	Measurement error (out of specification range, near point side) * Measured value: Transmission of 32000
	0x8CA2	Notification	Measurement error (out of specification range, far point side) * Measured value: Transmission of -32000
Display of measured value	0x8CA3	Notification	Low incident light intensity
Display of measured value	0x8D00	Caution	Operating time exceeded
Display of measured value	0x8D01	Caution	Max. number of the nonvolatile memory save operations exceeded

#### **DIMENSIONS (Unit: mm in)**

CAD data can be downloaded from our website.

#### HG-C1□0 HG-C1□0-P

Sensor

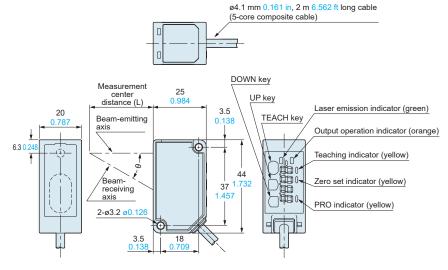


Model No.	Measurement center distance (L)	θ
HG-C1030(-P)	30 1.181	30°
HG-C1050(-P)	50 1.969	22.5°
HG-C1100(-P)	100 3.937	12.5°
HG-C1200(-P)	200 7.874	6.3°
HG-C1400(-P)	400 15.748	3.2°

400 15.748

3.2°

HG-C1400L3-P(-J)

#### HG-C□L3-P HG-C□L3-P-J <Discrete wire type HG-C□L3-P> <M12 connector type HG-C<sub>D</sub>L3-P-J> ø4 ø0.157 cable 2 m 6.562 ft (44.7 1.760) ø4 ø0.157 cable DOWN key Measurement center distance (L) Laser emission indicator (Green) Beam-emitting TEACH key axis Output operation indicator (Orange) Measurement θ Model No. Teaching indicator (Yellow) center distance (L) HG-C1030L3-P(-J) 30 1.181 30° Zero set indicator (Yellow) receiving HG-C1050L3-P(-J) 1.969 22.5° 50 axis PRO indicator (Yellow) 2-ø3.2 ø0.126 HG-C1100L3-P(-J) 100 3.937 12.5° HG-C1200L3-P(-J) 200 7.874 6.3° 18 0.70 3.5

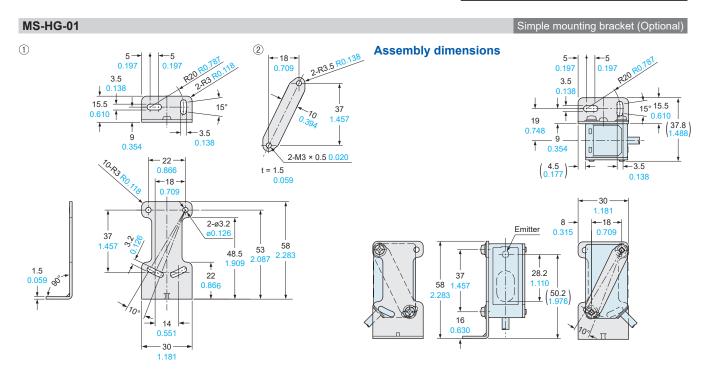

Material: Stainless steel (SUS304)

Two M3 (length 25 mm 0.984 in) screws with washers (SPCC) are attached.

#### Disclaimer

The applications described in the catalog are all intended for examples only. The purchase of our products described in the catalog shall not be regarded as granting of a license to use our products in the described applications. We do NOT warrant that we have obtained some intellectual properties, such as patent rights, with respect to such applications, or that the described applications may not infringe any intellectual property rights, such as patent rights, of a third party.



Ramco Innovations

(800) 280-6933

www.panasonicsensors.com